


AGL Hydro

Bushfire Mitigation Plan 2021-2022

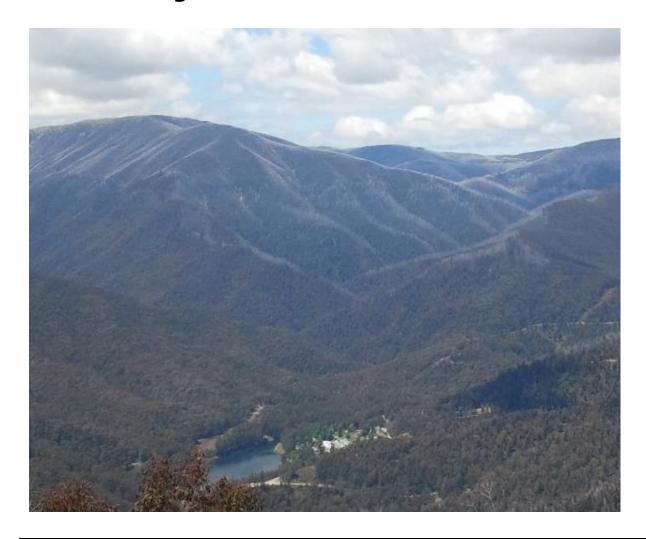

Hydro DMS: ML AL FI 01 (Rev5.2)

Table of Contents

| 1. | Regulation Compliance Summary | 7 |
|------|--|----|
| 1.1. | Victorian Regulation Compliance | 7 |
| 1.2. | NSW Regulation Compliance | 9 |
| 2. | Responsibilities | 10 |
| 2.1. | Responsible Persons | 10 |
| 2.2. | Management Structure and Responsibilities | 11 |
| 3. | References | 11 |
| 3.1. | Victorian | 11 |
| 3.2. | New South Wales | 12 |
| 4. | Policy | 12 |
| 5. | Plan Objectives | 12 |
| 6. | Scope | 13 |
| 6.1. | Overview | 13 |
| 6.2. | Maps | 13 |
| 7. | Prevention Strategies | 13 |
| 7.1. | Preventative Programs | 13 |
| 7.2. | Monitoring of Asset Condition and Vegetation | 14 |
| 7.3. | Engineered Solutions | 14 |
| 7.4. | Hardware Maintenance and Replacement | 14 |
| 7.5. | Victorian Powerline Bushfire Safety Program | 15 |
| 7.6. | Private Overhead Electric Lines | 15 |
| 7.7. | Key Timings | 15 |
| 8. | Inspection Programs | 16 |
| 8.1. | Inspection Methodology | 16 |
| 8.2. | Load Assessments | 16 |
| 8.3. | Asset Performance and Health Index | 16 |
| 8.4. | Visual Inspections | 17 |
| 8.5. | Inspection Schedule | 17 |
| 8.6. | High Voltage Cross Arms | 17 |
| 8.7. | Personnel | 17 |
| 9. | Qualifications, Training and Competency | 18 |
| 9.1. | Qualifications, Training and Competencies | 18 |

| 9.2. | Competency and Refresher Requirements | 18 |
|---------|--|----|
| 9.2.1. | Asset Management | 18 |
| 9.2.2. | Vegetation Management | 19 |
| 9.2.2.1 | . Qualification and Competencies | 19 |
| 10. | Operations and Maintenance Plans | 21 |
| 10.1. | Event of a Fire | 21 |
| 10.2. | Days of Total Fire Ban and Fire Emergencies | 21 |
| 10.3. | During the Fire Danger Period | 22 |
| 11. | Investigations, Analysis and Methodology | 22 |
| 11.1. | Fire Reporting and Investigations | 22 |
| 11.1.1. | Definitions | 22 |
| 11.1.2. | Fire Reporting Procedures | 22 |
| 11.1.3. | Pole Fire Report | 23 |
| 11.1.4. | Pole and Cross arm Failure Report | 23 |
| 11.1.5. | Report to Energy Safe Victoria | 23 |
| 11.1.6. | Investigations | 23 |
| 11.2. | Response Review and Reporting | 24 |
| 11.3. | Assistance from Fire Agencies for Fires near Electrical Assets | 24 |
| 12. | Processes and Procedures | 24 |
| 12.1. | Implementation Monitoring | 24 |
| 12.1.1. | General | 24 |
| 12.1.2. | Preparedness Reviews | 25 |
| 12.1.3. | Plan Effectiveness and Monitoring | 25 |
| 12.1.4. | Performance Indicators | 26 |
| 12.2. | Implementation Verification | 26 |
| 12.3. | Implementation Deficiencies | 26 |
| 12.4. | Changes to the Plan's Implementation | 27 |
| 12.5. | Monitor Effectiveness of Inspections | 27 |
| 12.6. | Verification of the Effectiveness of Inspections | 27 |
| 13. | Assistance Provided to Fire Control Authorities | 27 |
| 13.1. | Investigations of fires | 28 |
| 13.2. | Liaison with Management Agencies | 28 |
| 14. | Public Awareness Programs | 28 |
| 15. | Plan available for inspection | 28 |
| 16. | Victorian Assets | 29 |
| 16.1. | Kiewa Hydro Scheme Assets | 30 |
| 16.1.1. | Mount Beauty Depot and Regulating Pondage | 30 |

| 16.1.2. | West Kiewa Power Station | 30 |
|---------|--|----|
| 16.1.3. | Clover Power Station | 31 |
| 16.1.4. | Bogong Power Station | 31 |
| 16.1.5. | McKay Creek Power Station | 32 |
| 16.2. | Dartmouth Hydro Scheme Assets | 32 |
| 16.2.1. | Dartmouth Power Station | 32 |
| 16.2.2. | Banimboola Power Station | 33 |
| 16.3. | Yarrawonga Power Station Assets | 33 |
| 16.4. | Eildon Power Station Assets | 34 |
| 16.5. | Kiewa Hydro Scheme Overhead Powerlines | 35 |
| 16.5.1. | Kiewa – Mount Beauty Depot | 35 |
| 16.5.2. | Kiewa – West Kiewa | 35 |
| 16.5.3. | Kiewa – Clover and Bogong Creek Raceline | 36 |
| 16.5.4. | Kiewa – Bogong | 36 |
| 16.5.5. | Kiewa – McKay Crk PS | 37 |
| 16.6. | Rubicon Hydro Scheme Assets | 38 |
| 16.6.1. | Lower Rubicon PS | 38 |
| 16.6.2. | Rubicon PS | 38 |
| 16.6.3. | Rubicon Fall PS | 39 |
| 16.6.4. | Royston PS | 39 |
| 16.7. | Rubicon Hydro Scheme Overhead Powerlines | 40 |
| 16.7.1. | Rubicon A - Rubicon PS (Image 1) | 41 |
| 16.7.2. | Rubicon A - Rubicon PS including Lower Rubicon (Image 2) | 41 |
| 16.7.3. | Rubicon A - Rubicon PS (Image 3) | 42 |
| 16.7.4. | Rubicon PS | 42 |
| 16.7.5. | Rubicon Falls PS | 43 |
| 16.7.6. | Royston PS | 43 |
| 16.8. | NSW Assets | 44 |
| 16.8.1. | Pindari Power Station | 45 |
| 16.8.2. | Copeton Power Station | 46 |
| 16.8.3. | Burrendong Power Station | 49 |
| 16.8.4. | Glenbawn Power Station | 51 |
| 17. A | Appendices | 53 |
| 17.1. | Reporting Organisational Structure | 53 |
| 17.2. | AGL Hydro at-risk electric lines | 55 |
| 17.3. | Fire Report Form | 57 |
| 17.4. | Pole Fire Report Form | 60 |

Release Number: 22

Owner: Hydro Manager

| 17.5. | Pole and Cross Arm Failure Report | 63 |
|----------|---|----|
| 17.6. | Bushfire Rating Index | 65 |
| 17.7. | Engineered Solutions | 66 |
| 17.8. | Victorian Asset Firefighting Capability Statement | 67 |
| 17.9. | AGL Hydro Vegetation Types | 68 |
| 17.9.1. | Mt Beauty | 68 |
| 17.9.2. | Kiewa Scheme | 69 |
| 17.9.3. | Rubicon Scheme | 70 |
| 17.10. | Works and Verification Schedule | 71 |
| 17.10.1. | Kiewa Scheme (SAP Extract) | 72 |
| 17.10.2. | Rubicon Scheme (SAP Extract) | 73 |
| 10 🗆 | Poforopood Documents / Procedures | 74 |

Release Number: 22 Owner: Hydro Manager

Plan Revision History

| Date | Version | Author | Comment | Sections |
|------|----------------|-----------|---|--|
| 1.0 | 1 July 2016 | S. Cariss | Initial 2016/17 Draft | All |
| 1.1 | 11 Sep 2016 | All | BMP Working Group Review | All |
| 2.0 | 1 Oct 2016 | S. Cariss | Release 2016/2017 | All |
| 2.1 | 28 Dec 2016 | S. Cariss | Revised to include ESV Comments | All |
| 3.0 | 01 Aug 2017 | S. Cariss | BMP Working Group Review | All |
| 3.1 | 12 Feb 2018 | S. Cariss | Amendments following recommendations from ESV (Greg Sieburn) | Section 2 Section 7.4.1 Section 7.5 Section 13 |
| 4.0 | 01 Aug 2018 | S. Cariss | BMP Working Group Review | All |
| 4.1 | 07 Dec 2018 | S. Cariss | Website URL updated | Section 2 |
| 4.2 | 27 June 2019 | S. Cariss | Annual review AGL Hydro | All |
| 4.3 | 09 July 2020 | S. Cariss | Annual review AGL Hydro | All |
| 4.4 | 25 Aug 2020 | S. Cariss | ESV review feedback | Regulation Ref 6(h) Section 7.4.1 Section 9.5 Section 10.1 |
| 5.0 | 18 June 2021 | S. Cariss | Annual AGL Hydro review | All |
| 5.1 | 29 June 2021 | S. Cariss | Minor changes resulting from the annual review and following the ESV Line Clearance Plan Systems Audit. | All |
| 5.2 | 20 August 2021 | S. Cariss | Changes resulting from the annual ESV review and approval processes. | All |

Distribution

Release Number: 22

Owner: Hydro Manager

| Сору | Position |
|-----------------|--------------------------------------|
| 1 | AGL Hydro Reception |
| Electronic File | Energy Safe Victoria |
| Electronic File | Head of Hydro |
| Electronic File | Works Team Supervisor |
| Electronic File | Operations and Governance Manager |
| Electronic File | Works Team Supervisor |
| Electronic File | Works Team Leader - Eildon |
| Electronic File | Works Team Leader - Outlying Works |
| Electronic File | HSE Business Partner |
| Electronic File | AGL Web Site |
| Electronic File | AGL Hydro Document Management System |

Approved Date: 04/11/2021 Approved By: Stuart Cariss (A119880) Uncontrolled When Printed

Document ID: 9708169 Next Review Date: 03/11/2022 6 of 74

1. Regulation Compliance Summary

1.1. Victorian Regulation Compliance

Electricity Safety (Bushfire Mitigation) regulations 2013

Regulation 6: Prescribed particulars for bushfire mitigation plans - Specified Operators

Specified operator legal entity

AGL HP1 Pty Ltd (ACN 080 429 901); and

AGL HP2 Pty Ltd (ACN 080 810 546); and

AGL HP3 Pty Ltd (ACN 080 735 815)

Trading as AGL Hydro Partnership (ABN 86 076 691 481)

| Reg | Requirement | Reference in this Plan |
|----------|--|---------------------------------|
| 6 (1)(a) | the name, address, and telephone number of the specified operator | Responsible Persons (Section 2) |
| 6 (1)(b) | the position, address and telephone number of the person who was responsible for the preparation of the plan | Responsible Persons (Section 2) |
| 6 (1)(c) | the position, address and telephone number of the persons who are responsible for carrying out the plan | Responsible Persons (Section 2) |
| 6 (1)(d) | the telephone number of the specified operator's control room so that persons in the room can be contacted in an emergency that requires action by the specified operator to mitigate the danger of bushfire | Responsible Persons (Section 2) |
| 6 (1)(e) | the bushfire mitigation policy of the specified operator to minimise the risk of fire ignition from its at-risk electric lines | Policy (Section 4) |
| 6 (1)(f) | the objectives of the plan to achieve the mitigation of fire danger arising from the specified operator's at-risk electric lines | Objectives (Section 5) |
| 6 (1)(g) | a description, map or plan of the land to which the bushfire mitigation plan applies, identifying the location of the specified operator's at-risk electric lines | Scope (Section 6) |

AGL Hydro Bushfire Mitigation Plan 2021-2022 (ML APPTOYS) Date: 04/11/2021 Document ID: 9708169
Release Number: 22 Approved By: Stuart Cariss (A119880) Next Review Date: 03/11/2022
Owner: Hydro Manager Uncontrolled When Printed 7 of 74

| Reg | Requirement | Reference in this Plan |
|---------------|---|---|
| 6 (1)(h) | the preventative strategies and programs to be adopted by the specified operator to minimise the risk of the specified operator's at-risk electric lines starting fires | Preventative Strategies (Section 7) |
| 6 (1)(i) | a plan for inspection that ensures that all of the specified operator's at-risk electric lines are inspected at regular intervals of no longer than 37 months | Inspection Programs (Section 8) |
| 6 (1)(j) | details of the processes and procedures for ensuring that each person who is assigned to carry out the inspections referred to in paragraph (i) has satisfactorily completed a training course approved by Energy Safe Victoria and is competent to carry out such inspections | Qualifications, Training and Competency (Section 9) |
| 6 (1)(k) | details of the processes and procedures for ensuring that persons (other than persons referred to in paragraph (j)) who carry out or will carry out functions under the plan are competent to do so | Operations and Maintenance Plans (Section 10) |
| 6 (1)(l)(i) | the operation and maintenance plans for the specified operator's at-risk electric lines — in the event of a fire | Operations and Maintenance Plans (Section 10) |
| 6 (1)(I)(ii) | the operation and maintenance plans for the specified operator's at-risk electric lines — during a total fire ban day | Operations and Maintenance Plans (Section 10) |
| 6 (1)(I)(iii) | the operation and maintenance plans for the specified operator's at-risk electric lines — during a fire danger period | Investigations, Analysis and Methodology (Section 11) |
| 6 (1)(m) | the investigations, analysis and methodology to be adopted by the specified operator for the mitigation of the risk of fire ignition from its at- risk electric lines | Processes and Procedures (Section 12) |
| 6 (1)(n)(i) | details of the processes and procedures by which the specified operator will— monitor the implementation of the bushfire mitigation plan | Processes and Procedures (Section 12) |
| 6 (1)(n)(ii) | details of the processes and procedures by which the specified operator will— Verification the implementation of the plan | Processes and Procedures (Section 12) |

| Reg | Requirement | Reference in this Plan |
|---------------|--|--|
| 6 (1)(n)(iii) | details of the processes and procedures by which the specified operator will— identify any deficiencies in the plan or the plan's implementation | Processes and Procedures (Section 12) |
| 6 (1)(n)(iv) | details of the processes and procedures by which the specified operator will— change the plan and the plan's implementation to rectify any deficiencies identified under subparagraph (iii) | Qualifications, Training and Competency (Section 9) |
| 6 (1)(n)(v) | details of the processes and procedures by which the specified operator will— monitor the effectiveness of inspections carried out under the plan | Processes and Procedures (Section 12) |
| 6 (1)(n)(vi) | details of the processes and procedures by which the specified operator will— Verification the effectiveness of inspections carried out under the plan | Processes and Procedures (Section 12) |
| 6 (1)(0) | the policy of the specified operator in relation to the assistance to be provided to fire control authorities in the investigation of fires near the specified operator's at-risk electric lines | Assistance Provided to Fire Control Authorities (Section 13) |

1.2. NSW Regulation Compliance

This plan is provided to meet the objectives and requirements of the NSW Electricity Supply (Safety and Network) Regulation 2014 in accordance with AS5577. This includes consideration of industry codes, guidelines, and practices as well as published standards. The primary objective of this plan is to ensure AGL Hydro's electrical infrastructure and associated sub-networks at our NSW small Hydro sites is safe in its design, construction, and operation and to support:

- (a) safety of members of the public
- (b) the safety of persons working on networks
- (c) the protection of property
- (d) the management of safety risks arising from the protection of the environment (for example, preventing bush fires that may be ignited by network assets)

2. Responsibilities

2.1. Responsible Persons

| Regulation 6 | Specification – Contact Details |
|---|--|
| 6 (1)(a) Name, address and telephone number of the specified operator | Simon Kelley Head of Hydro AGL Energy Kiewa Valley Hwy Mt Beauty 3699 Phone: 0429 002 094 Email: skelley@agl.com.au |
| 6 (1)(b) Position, address and telephone number of the person who was responsible for the preparation of the plan | Stuart Cariss Operations Governance Manager, Renewables AGL Energy Kiewa Valley Hwy Mt Beauty 3699 Phone: (03) 5754 3225 Email: scariss@agl.com.au |
| 6 (1)(c) Position, address and telephone number of the persons who are responsible for carrying out the plan | Col Perso Works Team Supervisor AGL Energy Kiewa Valley Hwy Mt Beauty 3699 Phone: 0428 348 595 Email: cperso@agl.com.au |
| 6 (1)(d) Telephone number of the specified operator's control room so that persons in the room can be contacted in an emergency that requires action by the specified operator to mitigate the danger of bushfire | AGL Dispatch Center Duty Generation Dispatcher 699 Bourke St Melbourne 3000 Phone: (03) 5754 3142 Email: agldc@agl.com.au |

Information, including a copy of the Plan is available to be viewed by the state regulatory agencies or members of the public at AGL Hydro's office located at Kiewa Valley Highway Mt Beauty or by appointment during normal business hours.

A copy of the Plan is also available on the AGL internet site at: https://www.agl.com.au/about-agl/how-we-source-energy/hydroelectric-assets

AGL Hydro Bushfire Mitigation Plan 2021-2022 (ML APPTOG) Date: 04/11/2021 Document ID: 9708169
Release Number: 22 Approved By: Stuart Cariss (A119880) Next Review Date: 03/11/2022
Owner: Hydro Manager Uncontrolled When Printed 10 of 74

2.2. Management Structure and Responsibilities

The AGL Hydro management structure with respect to this plan is as follows (refer to appendices):

Head of Hydro - responsible for:

- Overall management of AGL Hydro
- Timely completion and actioning of bushfire mitigation strategies; and
- Ensuring the actions of AGL Hydro meet legislative requirements.

Operations Governance Manager – responsible for:

- Compliance and Verification of the bushfire mitigation plan
- Ensure proper liaison with other fire attack and land management agencies; and
- Ensure the administration of the Bushfire Mitigation Plan meets legislative requirements

Works Team Supervisor – responsible for:

- Ensuring all outstanding work is completed in a timely manner and adequate resources are made available for the implementation of the plan
- Ensuring all outstanding compliance issues are addressed and to ensure that matters are communicated to senior management; and
- Ensuring all compliance and Verification outcomes are reported to the Operations Governance
 Manager in a timely manner

Works Team Leaders (Civil and Electrical) -- responsible for:

- Day to day operation of electric line asset maintenance in accordance with this plan
- Asset inspection, vegetation control program and liaison with other land management agencies in accordance with this plan; and
- Allocation of contracts, with the responsibility of ensuring training and competencies are maintained in accordance with this plan. Refer 4.5
- Development of the verification report prior to the declared fire season

Senior Electrical Engineer — responsible for:

- Providing technical advice as required to ensure that the assets are maintained to the required standard; and
- Assist with contractor evaluation and selection to ensure they are technically competent and can provide the required levels of service

3. References

3.1. Victorian

- AGL Hydro Line Clearance Plan 2021-2022
- AGL Hydro Electricity Safety Management Scheme 2015
- AGL Hydro Consultation, Communication and Dispute Resolution (HP AI AD 01)
- AGL Energy Customer Complaints Policy
- Electricity Safety Act 1998
- Electricity Safety (Electric Line Clearance) Regulations 2020
- Electrical Safety (General) Regulations 2019
- Electricity Safety (Management) Regulations 2019
- Electricity Safety (Bushfire Mitigation) Regulations 2013
- Electricity Safety (Bushfire Mitigation Duties) Regulations 2017

AGL Hydro Bushfire Mitigation Plan 2021-2022 (ML APPTOYS) Date: 04/11/2021 Document ID: 9708169
Release Number: 22 Approved By: Stuart Cariss (A119880) Next Review Date: 03/11/2022
Owner: Hydro Manager Uncontrolled When Printed 11 of 74

Australian Standard AS4373 Pruning of Amenity Trees

3.2. New South Wales

- Electricity Safety Act 1995
- Electricity (Consumer Safety) Act 2004 (Section 32)
- Electricity Supply (Safety & Network Management) Regulation 2014
- Service and Installation Rules 2019 of NSW
- NSW Code of Practice Installation Safety Management Plan
- NSW Code of Practice Managing Electrical Risks in the Workplace
- ISSC 4 Guideline for Managing Vegetation Near Powerlines

4. Policy

| Reg | Requirement |
|---------|---|
| ` , ` , | the bushfire mitigation policy of the specified operator to minimise the risk of fire ignition from its at-risk electric lines. |

AGL Hydro's management and employees are committed to avoiding fire ignition caused by electrical assets and achieving compliance with relevant legislative and regulatory requirements while encouraging innovation, system improvement and the effective use of our flexible resources. AGL Hydro's policy is to mitigate as far as practicable the risk of fire starting from those at-risk assets that AGL Hydro own.

This Bushfire Mitigation Plan outlines the policies, procedures, standards, codes, and guidelines that AGL Hydro applies to construction, operation and management of our electrical infrastructure and sub-networks. The Plan also provides an overview of AGL Hydro's bushfire risk management strategies in relation to key stakeholders including local government, government agencies and emergency services.

AGL Hydro is committed to maintaining fire safe assets by:

- Periodic inspection of the assets to identify the works necessary to maintain fire safety
- · Operation programs to remove or manage the identified risks; and
- Monitoring and reporting regimes to measure the state of preparedness for the declared bushfire season and the effectiveness or programs.

5. Plan Objectives

| Reg | Requirement |
|----------|---|
| 6 (1)(f) | the objectives of the plan to achieve the mitigation of fire danger arising from the specified operator's at-risk electric lines. |

The objectives of AGL Hydro's Bushfire Mitigation Plan are as follows:

- Public Safety
- Compliance by AGL Hydro with the Electricity Safety Act 1998 (Vic) and Electricity Safety Act 1995 (NSW) and associated regulations
- To maintain a program of inspection of assets on a regular basis dictated by the risks assessed at each location
- Reduce the risk of fire starting from its assets
- Vegetation management with compliance to minimum clearances and environmental practices
- Asset maintenance to a level consistent with industry standards

AGL Hydro Bushfire Mitigation Plan 2021-2022 (ML APPTOYS) Date: 04/11/2021 Document ID: 9708169
Release Number: 22 Approved By: Stuart Cariss (A119880) Next Review Date: 03/11/2022
Owner: Hydro Manager Uncontrolled When Printed 12 of 74

- Liaise with fire attack and land management agencies to formulate strategies to minimise damage to the environment in the case of bushfires
- Measurement, monitoring, reporting, and Verification of program achievement and performance including the rectification of non-conformances; and
- Regular assessment of all programs in accordance with the relevant standards, regulations, and codes.

6. Scope

6.1. Overview

AGL Hydro forms a key part of the AGL Renewables fleet which has one of the largest portfolios of Renewable generation assets across Australia. AGL Hydro was established from the breakup of the former State Electricity Commission of Victoria and now operates hydroelectric power stations across Victoria and NSW. Our three primary hydroelectric schemes are in the Kiewa, Dartmouth and Eildon catchments.

Overhead electric line assets in Victoria are in the Kiewa and Rubicon catchments, and within the Cairn Curran Power Station switchyard. Overhead electric line assets in New South Wales are in the Pindari, Copeton, Burrendong, and Glenabwn Power Station switchyards located at the base of Water NSW owned and operated dams. Maps identifying the areas where the assets are located are provided in the appendices.

AGL Hydro's bushfire mitigation strategy is described by this Bushfire Mitigation Plan along with other documents, including the Electric Line Clearance Management Plan (Vic), Position Statement on Joint Fire Fighting Roles (Vic), Line Inspection Manual (AEL Document ID: 9712402), the ESSA Guidelines for Design and Maintenance of Overhead Distribution and Transmission Lines, and all subordinate documents.

6.2. Maps

| Reg | Requirement |
|----------|--|
| 6 (1)(g) | a description, map or plan of the land to which the bushfire mitigation plan applies, identifying the location of the specified operator's at-risk electric lines. |

Refer to Appendices for the following maps of the land and location of at-risk electric lines:

- Kiewa Hydro Scheme Assets
- Dartmouth Hydro Scheme Assets
- Yarrawonga Power Station Asset
- Eildon Hydro Scheme Assets
- Rubicon Hydro Scheme Assets
- NSW Hydro Scheme Assets

7. Prevention Strategies

| Reg | Requirement |
|----------|--|
| 6 (1)(h) | the preventative strategies and programs to be adopted by the specified operator to minimise the risk of the specified operator's at-risk electric lines starting fires. |

7.1. Preventative Programs

AGL Hydro Bushfire Mitigation Plan 2021-2022 (ML APPTOYS) Date: 04/11/2021 Document ID: 9708169
Release Number: 22 Approved By: Stuart Cariss (A119880) Next Review Date: 03/11/2022
Owner: Hydro Manager Uncontrolled When Printed 13 of 74

The following preventative programs are adhered to, to minimise the risk of bushfire initiation AGL Hydro Assets:

- All conductor spans in all areas will be inspected prior to the start of the fire season to identify any trees
 infringing the clearance space and any other obvious line defects, which may be a cause of the ignition of
 fire. Inspections may be carried at other times depending on location and prevailing weather conditions
- The inspection will be carried out by the method determined by the Works Team Supervisor as the most appropriate in the circumstances including ground patrol or line inspection; and
- The clearance space prescribed in the line clearance regulations will always be maintained clear of vegetation. In carrying out the work necessary to achieve this, the duties assigned to the responsible person in the electric line clearance plans will be observed

7.2. Monitoring of Asset Condition and Vegetation

The procedures employed by AGL Hydro meet the requirements of electric line clearance regulations and include:

- Recurrent pruning and clearing will be conducted on a maximum 3-yearly cycle for hazardous fire areas, however, all reasonable efforts will be made to achieve an annual pruning and clearing cycle with the following objectives
- To maintain the clearance space during this period additional pruning and clearing will be required (regrowth space) and diseased and unstable vegetation in the area beyond this which is a hazard to the line (hazard space) must be removed or other remedial action taken
- Establishing the appropriate regrowth space will enable pruning and clearing to be limited to the 3-year cycle, but as this is dependent on climatic conditions during the cycle pre-summer, clearing may be necessary at some locations outside the normal cycle
- The pre-summer inspection program is produced by SAP and performed by Outlying Works staff
- The pre-summer Verification program of all AGL Hydro line assets for vegetation clearance is conducted by an independent, competent, external contractor on an annual basis. AGL Hydro monitors this program via regular Verifications of the contractors
- The ongoing inspection program is scheduled using SAP and undertaken by authorised competent employees and/or contractors (refer to the appendices)
- The ongoing Verification program consists of annual desktop Verifications of procedure and maintenance tasks and regular fault reporting arising out of routine line Verifications; and
- To maintain a high standard of compliance through technology and information exchange AGL Hydro undertakes to maintain best industry practice through regular communications and liaison with distribution and transmission network companies

7.3. Engineered Solutions

AGL Hydro will investigate engineering solutions prior to any clearing activities. Alternative methods shall be used where the benefits outweigh those of conventional practices.

AGL undertake to provide uniform and consistent asset management strategies for undertaking corrective (reactive) and preventive (pro-active) actions committed to avoiding fire ignition caused by electrical assets and achieving compliance with relevant legislative and regulatory requirements.

Asset management strategies comprise major capital upgrades and consideration to underground infrastructure aimed at reducing risk and ongoing O&M costs with respect to overhead lines and easements. (refer to the appendices).

7.4. Hardware Maintenance and Replacement

AGL Hydro Bushfire Mitigation Plan 2021-2022 (ML APPTOYS) Date: 04/11/2021 Document ID: 9708169
Release Number: 22 Approved By: Stuart Cariss (A119880) Next Review Date: 03/11/2022
Owner: Hydro Manager Uncontrolled When Printed 14 of 74

When conducting routine hardware and vegetation inspections AGL Hydro staff will note the absence of any cross-arm bird covers and arrange to have them replaced during the next scheduled line maintenance opportunity, or arrange an outage for replacement, prior to the commencement of the declare bushfire season.

AGL undertake to remove brown insulator hardware during the normal cyclic maintenance of overhead line assets. AGL Hydro has one Expulsion Drop out Fuse (EDO) at Cairn Curran Power Station. The replacement of this EDO is not planned although catchers for molten metal have been attached for compliance with bushfire mitigation standards.

AGL Hydro no longer has any pole mounted powder filled fuses (PFFs). There are however PFFs on station service transformers in the Rubicon Scheme. These areas have had risk assessments undertaken on the possibility of a fire start due to a malfunction and have been deemed to be safe in situ until a replacement program is undertaken

AGL Hydro has instructed its line maintenance service providers that all work carried out and hardware purchased and installed on AGL Hydro's behalf must be fully compliant with all bushfire mitigation standards.

7.5. Victorian Powerline Bushfire Safety Program

The Victorian Government recently introduced enhanced powerline fault detection and suppression requirements to reduce the risk of bushfires caused by faults on the state's regional and rural powerline networks including Rapid Earth Fault Current Limiter (REFCL) protection.

These requirements have been added to the Electricity Safety (Bushfire Mitigation) Regulations 2013 (Regulations) and form part of a raft of measures that have been undertaken as part of the Victorian Government Powerline Bushfire Safety Program (PBSP).

AGL has completed the necessary regulatory reviews to ensure all legislative obligations associated with the effect of a REFCL operation on our sub-network and equipment are met in readiness for our assets served by tranche one zone substation works for Rubicon A zone substation.

AGL will take reasonable precautions to minimise the risk of loss or damage to our equipment, premises or business that may result from the over-voltages that occur when a REFCL operates and will update this plan to reflect any at-risk electric lines and to demonstrate how our sub-network and equipment will operate safety during over-voltages associated with REFCL operation for approval by ESV.

7.6. Private Overhead Electric Lines

All AGL Hydro overhead line assets are either used for the transmission of generated electricity to the network supplier point of connection or used for the consumption of electricity from the network supplier point of connection. AGL Hydro is not a retailer that supplies customers via POEL's.

7.7. Key Timings

Key timings for preventative strategies are as follows:

- The Bushfire Mitigation Plan (BMP) will be completed and submitted to Energy Safe Victoria prior to the 1st of July each year
- The Electric Line Clearance Management Plan (LCP) will be completed prior to the 31st of March each year and submitted to Energy Safe Victoria upon request
- The agreed Bushfire Mitigation Index (BMI) will be submitted to Energy Safe Victoria by the end of each calendar month during the declared season
- The NSW HV customer Installation Safety Management Plans (ISMP) will be completed and available to the NSW transmission or distribution network companies prior to the 1st of September each year
- Inspection program dates are triggered by SAP (refer to the appendices)
- · Timing for rectification works are determined by the priority status of work found; and
- Desktop Verification of plan & fire procedures shall occur in the first week of November each year.

AGL Hydro Bushfire Mitigation Plan 2021-2022 (ML APPTOYS) Date: 04/11/2021 Document ID: 9708169
Release Number: 22 Approved By: Stuart Cariss (A119880) Next Review Date: 03/11/2022
Owner: Hydro Manager Uncontrolled When Printed 15 of 74

8. Inspection Programs

| Reg | Requirement |
|----------|--|
| 6 (1)(h) | the preventative strategies and programs to be adopted by the specified operator to minimise the risk of the specified operator's at-risk electric lines starting fires. |
| 6 (1)(i) | a plan for inspection that ensures that all of the specified operator's at-risk electric lines are inspected at regular intervals of no longer than 37 months. |

8.1. Inspection Methodology

The purpose of the inspection programs is to assess the condition of electricity generation and distribution assets, record test results and observations, and log results for further evaluation and action. Inspection programs have been designed for the surveillance of identified causes of fire ignition.

Structures are assessed using an infra-acoustic scanning technique (Woodscan®) to determine the residual strength at, or just above, ground line. Initially, the residual strength is determined as a percentage of the structures original strength given the structures strength group and size attributes.

The serviceability criteria assume that all structures were designed to an industry safety factor of 2.5:1. Our contracted service providers normally recommend that a limited state engineering analysis is undertake to structures found to be limited life or unserviceable. The flow chart below represents the serviceability rules adopted by SP Ausnet in Eastern Victoria. We have applied these rules to these assets because of the location of the project (within Ausnet supply area).

8.2. Load Assessments

It is critical that all load and structure information is associated with a directional bearing. These bearings are based on along-line and across-line coordinates from 0-360 degrees. To assess the applicable load of a structure we measure the following attributes:

- Exposed pole height
- Conductor sizes (including service cables)
- · Span lengths, slope, and bearings
- Cross arm types and sizes
- Attachment heights for all attachments
- Stay attributes; and
- Exposure

8.3. Asset Performance and Health Index

Structures conforming to the requirements of the standard AS/NZS 7000 should have a Health Index (HI) greater than 1.0. (The 'Health Index' is the key performance measurement for serviceability and is calculated as 'factored strength over factored load').

The risk rating is based on the Serviceability category based on 'Residual Strength' as described in the flow chart above and the applicable loadings as measured in the field and defined in AS/NZS 7000. The risk table applicable to our assessments is:

| WoodScan® status | Sustained Health Index | Ultimate Health Index | Both Indices |
|------------------|------------------------|-----------------------|--------------|
| Measure | < 1.0 | < 1.0 | => 1.0 |
| Serviceable | Medium | Low | Very Low |

AGL Hydro Bushfire Mitigation Plan 2021-2022 (ML APPTOYS) Date: 04/11/2021 Document ID: 9708169
Release Number: 22 Approved By: Stuart Cariss (A119880) Next Review Date: 03/11/2022
Owner: Hydro Manager Uncontrolled When Printed 16 of 74

| Limited Life | High | Medium | Low |
|---------------|----------|-----------|--------|
| Unserviceable | Critical | Very High | Medium |

8.4. Visual Inspections

Visual inspections of overhead electric line assets is undertaken by our contracted service providers utilising powered image stabilised binoculars and digital SLR cameras and includes, but is not limited to, the following:

- Cross-arms
- Poles
- Insulators
- Conductors
- Connectors
- Stays
- Transformers
- Switches
- Fusing and HV apparatus
- Earthing
- · Vegetation; and
- Design

8.5. Inspection Schedule

The following inspections are undertaken:

- Pole top inspection is conducted on a 3-year cyclic rotation. Inspection results are recorded in the AGL computerised maintenance management system
- All poles, cross arms, conductors, and hardware belonging to AGL Hydro are inspected and tested on a 3-year cyclic rotation
- A Vegetation Line Clearance Verification of all AGL Hydro line assets is conducted annually by an appropriately qualified contractor with results recorded in AGL computerised maintenance management system

All issues or actions arising from any of these inspections are entered as jobs in the computerised maintenance management system SAP (refer to the appendices) and prioritised below. These SAP entries are reviewed as part of the annual Verification to ensure items have been completed in the required timeframe.

| Priority/Code | Description |
|----------------------|--|
| P1 (Immediate) | Requires immediate remedial action |
| P2 (Break Schedule) | Requires high priority remedial action within the current working week |
| P3 (Next Sched Week) | Requires high priority remedial action within the next working week |
| P4 (Start 2-4 weeks) | Requires remedial action within 2-4 weeks during fire & non fire season |
| P5 (Start 4+ weeks) | Requires further assessment or remedial action within a period greater than 4 weeks in normal maintenance timeframes |

8.6. High Voltage Cross Arms

Deteriorated HV cross-arms, where detected, will be replaced by galvanised steel cross-arms to prevent further deterioration and failure.

8.7. Personnel

This section outlines the process to be employed by all personnel, including contracted staff, carrying out asset inspections and tests carried out in a responsible manner and applies to all persons associated with this management plan.

All personnel, including contracted staff, must have satisfactorily completed the required competency-based training and their performance verified on an annual basis.

Random verifications are completed on all work conducted by contractors during the currency of each task. Any non-compliance issues are communicated to the relevant contractor or employee and corrective actions are taken immediately. These are recorded for verification purposes.

Qualifications, Training and Competency

| Reg | Requirement |
|----------|---|
| 6 (1)(j) | details of the processes and procedures for ensuring that each person who is assigned to carry out the inspections referred to in paragraph (i) has satisfactorily completed a training course approved by Energy Safe Victoria and is competent to carry out such inspections. |
| 6 (1)(k) | details of the processes and procedures for ensuring that persons (other than persons referred to in paragraph (j)) who carry out or will carry out functions under the plan are competent to do so. |

9.1. Qualifications, Training and Competencies

Workers shall only undertake work for which they have been trained, assessed, and deemed competent to enable them to safely perform work and all relevant contractors must have sufficient knowledge, training, qualifications, and experience to ensure that tree activities under their control are conducted in a safe and environmentally responsible manner.

AGL Hydro engages contractors to perform annual inspections of at-risk electric assets and all work is carried out by suitably qualified and licensed personnel having experience in the types of work as laid out in the VESI framework.

AGL Hydro contractors who are suitably qualified will be considered as an "authorised person" or under the control of an authorised person under the Victorian High Voltage Code of practise on electrical safety for the work on or near high voltage electrical apparatus.

AGL Hydro records all contractor training and qualifications in the 'RAPID Global' and 'cm3' contractor management application systems including ensuring routine refresher training in relevant modules are current and work can be undertaken in a safe competent manner. Training records will be available prior to commencement of works or made accessible via the individuals Australian ESI Skills Passport.

AGL Hydro will have a representative responsible for carrying out this plan on site at the commencement of the inspections/clearance to observe/conduct appropriate inductions which may include such a request for records. If any worker associated with the work tasks covered under this plan are found to be performing works without required training/qualifications/experience or outside of their capabilities or the prescribed documentation, they are supposed to be working under then work will be immediately stopped and the associated personnel removed from the site.

9.2. Competency and Refresher Requirements

9.2.1. Asset Management

The following table outlines the Units of Competency required to be undertaken for the applicable Asset

AGL Hydro Bushfire Mitigation Plan 2021-2022 (ML APPTOYS) Date: 04/11/2021 Document ID: 9708169
Release Number: 22 Approved By: Stuart Cariss (A119880) Next Review Date: 03/11/2022
Owner: Hydro Manager Uncontrolled When Printed 18 of 74

Management and Inspection roles AGL Hydro. All Mandatory (M) units of competency shall be completed to undertake the role.

| Qualification | on and Core Competency and Refresher Standard | Competency Standard Unit | Asset Inspector | Asset Inspector Trainee |
|---------------|---|-----------------------------|-----------------|-------------------------|
| Qualification | on | | | |
| Certificate I | in Asset Inspection | UET20312 | М | М |
| | afety rules, codes of practice and procedures for work on or near electrical Green Book / Blue book) | UETTDRRF01B | М | М |
| Prepare to v | work safely in the construction industry | CPCCOHS1001A | М | М |
| Working sat | ely near live electrical apparatus as a non-electrical worker | UETTDREL14A | М | М |
| Refresher I | Requirements | | | |
| 3 Yearly | Apply ESI safety rules, codes of practice and procedures for work on or near electrical apparatus (Blue book) | UETTDRRF01B | М | М |
| 3 Yearly | Apply access procedures to work on or near electrical network infrastructure (Receive Access Permit) | UETTDRRF09B | М | М |
| 3 Yearly | Control traffic with stop-slow bat | RIIWHS205D | М | М |
| 3 Yearly | Implement traffic management plan | RIIWHS302D | М | М |
| 3 Yearly | Manual Handling | | М | М |
| 3 Yearly | VESI Environmental Framework | | М | М |
| 3 Yearly | VESI Safety Framework | | М | М |
| 1 Year | Cardiopulmonary Resuscitation (CPR) | HLTAID001 | М | М |
| 1 Year | First Aid in an ESI environment | UETTDRRF10B | М | М |
| Other Requ | uirements | | | |
| ESI Worker | Card | | М | М |
| Network Op | Network Operator Induction | | М | М |

M – Mandatory; A – Additional (If worker requires for the works being performed)

9.2.2. Vegetation Management

The following table outlines the Units of Competency required to be undertaken for the applicable Vegetation role at AGL Hydro. All Mandatory (M) units of competency shall be completed to undertake the role.

9.2.2.1. Qualification and Competencies

| Qualification and Core Competency Standard | Competency Standard Unit | Assessor | Cutter Working from EWP | Specialist Plant Operator | Tree Climber |
|--|-----------------------------|----------|-------------------------|---------------------------|--------------|
| Qualification | | | | | |
| Certificate II in ESI - Powerline Vegetation Control | UET20312 | М | М | М | М |
| Apply ESI safety rules, codes of practice and procedures for work on or near electrical apparatus (Green Book / Blue book) | UETTDRRF01B | М | M | M | M |
| Elective Competency Standard Units | | | | | |
| Use climbing techniques to cut vegetation above ground near live electrical apparatus | UETTDRVC21A | | | | М |
| Assess vegetation and recommend control measures in an ESI environment | UETTDRVC24A | М | | | |
| Use elevated platform to cut vegetation above ground level near live electrical apparatus | UETTDRVC25A | | М | | |
| Operate specialist equipment at ground level near live electrical apparatus | UETTDRVC31A | | | А | |
| Use specialised plant to cut vegetation above ground level near live electrical apparatus | UETTDRVC32A | | | М | |
| Apply pruning techniques to vegetation control near live electrical apparatus | UETTDRVC33A | | М | М | М |
| Undertake release and rescue from a tree near live electrical apparatus | UETTDRVC34A | | | | М |
| Fell small trees | AHCARB202A | | Α | Α | Α |
| Undertake standard climbing techniques | AHCARB204A | | | | М |
| Apply chemicals under supervision | AHCCHM201A | | Α | Α | Α |
| Operate machinery and equipment | AHCMOM304A | | Α | М | Α |
| Recognise plants | AHCPCM201A | М | Α | Α | Α |
| Operate a mobile chipper/mulcher | FPIHAR2206B | | Α | Α | Α |
| Licence to operate a boom-type elevating work platform (boom length 11 metres or more) | TLILIC2005A | | М | | |

M – Mandatory; A – Additional (If worker requires for the works being performed)

9.2.3. **Refresher Requirements**

20 of 74

| Frequency | Qualification and Core Competency Standard | Competency Standard Unit | Assessor | Cutter Working from EWP | Specialist Plant Operator | Tree Climber |
|-----------|---|-----------------------------|----------|-------------------------|---------------------------|--------------|
| 3 Yearly | Apply ESI safety rules, codes of practice and procedures for work on or near electrical apparatus (Blue book) | UETTDRRF01B | M | M | M | М |
| 3 Yearly | Apply access procedures to work on or near electrical network infrastructure (Receive Access Permit) | UETTDRRF09B | М | М | М | М |
| 1 Year | Cardiopulmonary Resuscitation (CPR) | HLTAID001 | М | М | М | М |
| 1 Year | First Aid in an ESI environment | UETTDRRF10B | М | М | М | М |
| 1 Year | EWP Controlled Descent Escape | UETTDRRF08B | | М | | |
| 1 Year | EWP Rescue | UETTDRRF03B | | М | | |
| 1 Year | Undertake release and rescue from a tree near live electrical apparatus | UETTDRVC34A | | | | М |

M – Mandatory; A – Additional (If worker requires for the works being performed)

10. Operations and Maintenance Plans

10.1. Event of a Fire

| Reg | Requirement |
|-------------|--|
| 6 (1)(I)(i) | the operation and maintenance plans for the specified operator's at-risk electric lines — in the event of a fire |

In the event of fire which prevents the safe operation of the HV overhead line, the line will be deenergised to minimise further ignition sources. Where the fire is in the area but presents minimal or no risk to the safe operation of the overhead line, the overhead line will continue to operate.

10.2. Days of Total Fire Ban and Fire Emergencies

| Reg | Requirement | | | |
|--------------|--|--|--|--|
| 6 (1)(I)(ii) | he operation and maintenance plans for the specified operator's at-risk electric lines — | | | |
| | during a total fire ban day | | | |

On days of Total Fire Ban and emergencies, the AGL Dispatch Centre Generation Dispatcher will inform team leaders of the declaration days of total fire ban, verbally and in writing before 7:30 am. Team leaders will organise to reschedule any planned works that may be considered by government fire service agencies, or under codes of practice, regulations, or statutory requirements, to pose a risk of fire ignition.

Where such tasks need to be performed to ensure the security and safety of the network all permits required by the government fire service agencies, or under codes of practice, regulations, or statutory requirements, will be obtained.

AGL Hydro does not have any reclose suppression line protection systems. Subject to safe access AGL Hydro high voltage pole assets in the Victorian Rubicon State Forest high risk area will be visually inspected subject to safe access, prior to 9:00am on Total Fire Ban days. Any potential hazards will be reported to the Works Team Supervisor and a decision made to remove the hazard or isolate the affected asset.

Records of events and instructions for days of Total Fire ban will be kept by AGL Hydro for inspection by regulatory and government fire service agencies if required. The Hydro Works Team Supervisor will remain in close liaison with government fire service in the approach to the fire season to confirm season start date.

10.3. During the Fire Danger Period

| Reg | Requirement |
|---------------|---|
| 6 (1)(I)(iii) | the operation and maintenance plans for the specified operator's at-risk electric lines — during a fire danger period |

AGL Hydro assets will be operated in accordance with normal operating practices during the declared fire danger periods.

11. Investigations, Analysis and Methodology

| Reg | Requirement |
|----------|--|
| 6 (1)(m) | the investigations, analysis, and methodology to be adopted by the specified operator for the mitigation of the risk of fire ignition from its at-risk electric lines. |

Electrical events/faults, if they influence risk of fire ignition from the sites at-risk electric lines or not, are recorded and reported using AGL Hydro's 'myHSE Event Report' which if considered to be a 'Serious Electrical Event', are reported separately to ESV and/or WorkSafe Victoria. For faults/incidents/defects requiring further internal investigation the 'Incident Reporting and Investigation Procedure' is followed.

11.1. Fire Reporting and Investigations

AGL Hydro undertakes to investigate and analyse all fire ignitions originating from its electric line assets.

11.1.1. Definitions

Fires are categorised under two definitions as follows:

- Fire: the ignition of combustible materials on the ground including trees and other vegetation possibly caused by AGL Hydro's assets; and
- Significant Fire: a fire which causes injury or death, or significant damage to stock or property which includes trees, pasture and fencing possibly caused by AGL Hydro's assets.

11.1.2. Fire Reporting Procedures

Should a fire occur, which may have been caused by AGL Hydro assets it is to be reported by:

- A telephone report to the Works Team Supervisor, Operations Governance Manager and Head of Hydro
- An HSE incident raised in the AGL Hydro HSE Management System (myHSE)

AGL Hydro Bushfire Mitigation Plan 2021-2022 (ML APPTOYS) Date: 04/11/2021 Document ID: 9708169
Release Number: 22 Approved By: Stuart Cariss (A119880) Next Review Date: 03/11/2022
Owner: Hydro Manager Uncontrolled When Printed 22 of 74

When reporting fires causing minimal damage, and where it is unlikely that there will be any media involvement, the Head of Hydro, Operations Manager and Works Team Supervisor must be provided with at least the following information:

- 1. Current status of the fire (ie. out, under control etc.)
- 2. Attendance of any other authority (Police, CFA)
- 3. Date and time of discovery
- 4. Pole number
- 5. Locality or line/spur name
- 6. Injured personnel
- Material damage
- 8. Line voltage
- 9. Possible cause; and
- 10. Details of preliminary information from the initial site inspection.

In the event of a significant fire, or if media involvement is likely, the Works Team Supervisor, Operations Governance Manager and Head of Hydro are to be provided with the following information, in addition to that above, as soon as possible:

- 1. Name of the person reporting the fire
- 2. Whether AGL Hydro Employees are still on site; and
- 3. If the police attended the incident.

Fire Report information must be submitted within 48 hours of first notification of the incident. Sufficient detail is to be included to allow a full understanding of the incident (including weather, pole/cross arm materials, conductor materials, etc.).

11.1.3. Pole Fire Report

In addition to the standard Fire Report Form, if a pole fire occurs the AGL Hydro nominated Works Team Leader involved must fill out a Pole Fire Report (refer appendices) and return the report to the Works Team Supervisor. Should the fire cause damage to non AGL Hydro assets, a Fire Report must also be submitted.

11.1.4. Pole and Cross arm Failure Report

Should a fire occur as the result of a pole, or cross arm failure, a Pole and Cross arm Failure Report (refer appendices) must be completed and returned to the Works Team Supervisor. Should a fire which damages AGL Hydro, or non AGL Hydro assets, occur as result of a pole or cross arm failure a Fire Report must also be completed and submitted.

11.1.5. Report to Energy Safe Victoria

If as the result of an incident, serious property damage, or a serious reduction in the level of public safety, has occurred or is likely to occur in Victoria, then all details of the incident must be reported to Energy Safe Victoria in accordance with the Electrical Safety Management Regulations 2009. Refer to the AGL Hydro Electrical Safety Management Scheme Manual for assistance with the reporting process requirements.

11.1.6. Investigations

In the event of any fire involving AGL Hydro assets; the Operations Governance Manager with the assistance of the Works Team Supervisor is to initiate an investigation into the cause and effects of the fire and produce if necessary, a plan for minimising the likelihood of a further similar occurrence. Every effort is to be made to commence the investigation within two calendar weeks of the incident and have the investigation completed and the recommendations and action plan produced within six calendar weeks of the incident. Investigation

AGL Hydro Bushfire Mitigation Plan 2021-2022 (ML APPTOYS) Date: 04/11/2021 Document ID: 9708169
Release Number: 22 Approved By: Stuart Cariss (A119880) Next Review Date: 03/11/2022
Owner: Hydro Manager Uncontrolled When Printed 23 of 74

findings, recommendations and action plans are then to be forwarded to the regulatory agencies for all notifiable incidents.

11.2. Response Review and Reporting

- AGL Hydro undertakes to respond as soon as practicable to all fires arising from their actions or asset. In
 the case of potential ignition sources from asset operations on days of total fire ban, AGL Hydro may
 open-off HV lines running through high-risk areas, dependent on weather conditions such as the Rubicon
 State Forest. All employees and contractors employed by AGL Hydro are instructed to report all fires
 immediately
- Bushfire Mitigation Plans, Electric Line Clearance Management Plans, Position Statement on Joint Fire
 Fighting Roles, Line Inspection Manuals, and all subordinate documents will be reviewed on an annual
 basis or more frequently if required
- All AGL Hydro procedures, documentation and asset readiness relating to bushfire mitigation, shall be
 reviewed each year in August prior to declaration of the fire season. All corrective actions identified shall
 be identified prior to the declaration of the fire danger period. A verification report and progress on
 corrective actions shall form part of the annual review of the plan prior to the declaration of the fire
 season; and
- AGL Hydro shall forward the bushfire mitigation index (refer to the appendices) relating to the Victorian assets to Energy Safe Victoria monthly during the declared period.

11.3. Assistance from Fire Agencies for Fires near Electrical Assets

The following procedures apply when assistance is required from fire agencies for fires near electrical assets:

- Access to assets for personal safety reasons no access to any high voltage source (eg: switchyards, HV Lines, Poles) by any fire authority or personnel is permitted without prior approval from an authorised employee of AGL Hydro
- Co-ordination of resources each year AGL Hydro shall circulate the AGL fire preparedness and capability statement with local fire agencies that includes the role of each agency in the event of a fire endangering or affecting any HV assets
- Appointed contact persons in the event of an incident affecting any AGL Hydro asset, the Duty Officer shall notify the Works Team Supervisor or his delegate for allocation of resources; and
- Information exchange AGL Hydro shall maintain a free exchange of information to all fire control
 agencies to enable a rapid, appropriate response to all incidents. The Works Team Supervisor will use
 this information exchange to best advantage to identify risks to and from AGL Hydro Assets and
 effectively apply lessons learnt from past events to manage future fire risk.

12. Processes and Procedures

12.1. Implementation Monitoring

| Reg | Requirement |
|-------------|--|
| 6 (1)(n)(i) | details of the processes and procedures by which the specified operator will— monitor the implementation of the bushfire mitigation plan |

12.1.1. **General**

AGL Hydro Bushfire Mitigation Plan 2021-2022 (ML APPTOYS) Date: 04/11/2021 Document ID: 9708169
Release Number: 22 Approved By: Stuart Cariss (A119880) Next Review Date: 03/11/2022
Owner: Hydro Manager Uncontrolled When Printed 24 of 74

Monitoring the implementation of the plan is performed predominantly through the use and management of the AGL computerised maintenance management system (CMMS) which records any required scheduled or unscheduled works including, but not limited to, the preventative works listed in this plan.

The specific measure is the closure of maintenance work orders related to bushfire mitigation and line vegetation works which have a due date, or are required to be done, prior to the 1st of December or before the declared fire danger period each year, whichever is earlier.

This measure is referred to as the Bushfire Index and is calculated as follows:

Index Bushfire = Number of outstanding works / Total works required

12.1.2. Preparedness Reviews

AGL Hydro will undertake annual reviews of its bushfire preparedness in relation to overhead line assets and generation structures. Plan reviews by Senior Leaders, and other nominated staff, will be held annually to validate; the plan; the efficiency of maintenance programs, program compliance, and program relevance.

Random checks will be undertaken during October/November of each year into all facets of the implementation of the bushfire mitigation plan.

Plan reviews by Senior Leaders, include:

- The Operations Governance Manager
- The Works Team Supervisor
- The Senior Electrical Engineer
- Works Team Leader (Civil)
- Works Team Leader (Electrical); and
- Other nominated personnel as deemed necessary

Note: A delegate may be nominated in the absence of one of the above Leader.

Plan reviews will include checks and assessments of the following:

- Planning
- Monitoring inspections carried out
- Line maintenance database & SAP
- Urgent work
- Poles and Line hardware
- Trees/vegetation
- Communication effectiveness with the fire service agencies
- Response to days of Total Fire Ban and high fire danger; and
- HV switching procedures

All issues or actions arising from any of these reviews are entered as jobs in the computerised maintenance management system SAP (refer to the appendices) and prioritised as follows:

The Works Team Supervisor oversees each plan review and coordinates follow-up action to verify the implementation of the corrective action and that a works management work order is raised and tracked.

Records supporting the plan reviews will be made available to Energy Safe Victoria for review upon request Verification and will be independently verified every five years by external consultants.

The Works Team Supervisor shall ensure that bushfire mitigation index status reports are forwarded to the Operations Governance Manager and to Energy Safe Victoria during the currency of the declared fire season.

12.1.3. Plan Effectiveness and Monitoring

AGL Hydro Bushfire Mitigation Plan 2021-2022 (ML APPTOYS) Date: 04/11/2021 Document ID: 9708169
Release Number: 22 Approved By: Stuart Cariss (A119880) Next Review Date: 03/11/2022
Owner: Hydro Manager Uncontrolled When Printed 25 of 74

The results of plan reviews that identify deficiencies in the procedures or the plan implementation associated with the management of bushfire mitigation are added to the HSE management system and action register for further action and tracking. This register tracks the issue, responsible person, and progress status. The results of each plan review including the documented actions are advised to the Hydro Leadership Team.

The change to a procedure or this plan will be implemented in a timely manner depending on the significance of the issue identified. All items identified will be incorporated into the next annual revision of the manual.

12.1.4. Performance Indicators

Other performance measures which will be collated and reviewed annually prior to the resubmission of this plan to ESV include:

- Number of electrical events/faults that have occurred on the relevant Electric Lines with the cause identified to be directly related to their condition and/or compliance with the Regulations
- Annual Number of Fire Starts
- Number of Stakeholder complaints/correspondence received in relation to the relevant Electric Lines as measured through AGL Hydro's community and communications department
- Lost Time Injuries (LTI's) or Medical Treatment Injuries (MTI's) with the cause identified to be directly related to the Electric Lines
- Future Electric Line Clearance Plan submitted by 30th June each year
- Financial Penalties (Penalty Units) received

12.2. Implementation Verification

| Reg | Requirement |
|--------------|---|
| 6 (1)(n)(ii) | details of the processes and procedures by which the specified operator will— Verification the implementation of the plan |

Verification the implementation of the plan is largely done as part of the annual review process prior to resubmission of this plan to ESV and a review prior to the declared fire danger period which will be undertaken by a representative responsible for carrying out this plan which includes:

- that the qualifications and experience of personnel performing any scheduled inspection and/or clearance works adheres to both ESV's and this plans requirements
- associated report/s have been submitted to the persons responsible for carrying out this plan
- all inspections, reports, and subsequent recommendations from have been conducted in line with the scope/timing of recommendations and to the quality of this plan and the applicable Acts, Regulations, Codes and Standards; and
- the inspections and recommendations from the report, if any, have an appropriate task/s entered into the AGL Hydro SAP works management systems and those task/s have been closed out following completion or the works.

12.3. Implementation Deficiencies

| Reg | Requirement |
|---------------|--|
| 6 (1)(n)(iii) | details of the processes and procedures by which the specified operator will— identify any deficiencies in the plan or the plan's implementation |

Identification of any deficiencies in the plan or the plan's implementation is achieved through:

- the annual review process of this plan prior to resubmission to ESV
- Persons carrying out this plan to provide feedback to their Leader and/or the person/s responsible for the preparation of this plan when a deficiency is found

AGL Hydro Bushfire Mitigation Plan 2021-2022 (ML APPTOYS) Date: 04/11/2021 Document ID: 9708169
Release Number: 22 Approved By: Stuart Cariss (A119880) Next Review Date: 03/11/2022
Owner: Hydro Manager Uncontrolled When Printed 26 of 74

- AGL Hydro's critical control checks and workplace safety and environment observation/conversation
 program which requires employees and leaders to have routine observation/conversation which are
 entered into the AGL Hydro myHSE systems; and/or
- Review of site/asset risk registers.

12.4. Changes to the Plan's Implementation

| Reg | Requirement |
|--------------|---|
| 6 (1)(n)(iv) | details of the processes and procedures by which the specified operator will— change the plan and the plan's implementation to rectify any deficiencies identified under subparagraph (iii) |

Changes to the plan and the plan's implementation if any deficiencies are identified are performed during the annual review of this plan prior to resubmission to ESV.

If there are more critical changes required to important information, including but not limited to, contact details or applicable procedures/policies these will be performed as soon as possible and resubmitted to ESV. The updated plans will then be reloaded into AGL Hydro's enterprise library and on the AGL Hydro webpage listed in the plan.

The annual review of this plan is performed by the persons responsible for preparing the plan in conjunction with the other stakeholders and responsible persons listed in this plan. These include, but is not limited to, updating the plan for any new or revised Legislation, Regulations or Codes, industry practices and Electric Line configurations and/or locations.

12.5. Monitor Effectiveness of Inspections

| Reg | Requirement |
|-------------|---|
| 6 (1)(n)(v) | details of the processes and procedures by which the specified operator will— monitor the effectiveness of inspections carried out under the plan |

Monitor the effectiveness of inspections under the plan will be performed through the annual review of the performance measures listed above by the persons responsible for preparing the plan.

12.6. Verification of the Effectiveness of Inspections

| Reg | Requirement |
|--------------|--|
| 6 (1)(n)(vi) | details of the processes and procedures by which the specified operator will— Verification the |
| | effectiveness of inspections carried out under the plan |

Verification of the effectiveness of any inspections carried out under the plan is performed through conducting a ground based visual assessment following the completion of the 36-month Electric Line Inspection works. This will be performed by personnel who have:

- Knowledge of applicable Acts, Regulations and Codes associated with this plan
- Knowledge of this plan and its review and verification obligations
- Knowledge and are familiar with, the Electric Lines subject to the review and verification; and
- A minimum of 3 years Electric Line management experience; or
- An independent 3rd Party.

13. Assistance Provided to Fire Control Authorities

AGL Hydro Bushfire Mitigation Plan 2021-2022 (ML APPTOYS) Date: 04/11/2021 Document ID: 9708169
Release Number: 22 Approved By: Stuart Cariss (A119880) Next Review Date: 03/11/2022
Owner: Hydro Manager Uncontrolled When Printed 27 of 74

| Reg | Requirement |
|----------|---|
| 6 (1)(o) | the policy of the specified operator in relation to the assistance to be provided to fire control authorities in the investigation of fires near the specified operator's at-risk electric lines. |

13.1. Investigations of fires

AGL Hydro will allow access to and assist fire control authorities in the investigation of fires at or near the relevant Electric Lines.

13.2. Liaison with Management Agencies

AGL Hydro will maintain a representative on the local Shire or Municipal Fire Prevention Committees to ensure that fire mitigation strategies are in place and communicated prior to the declaration of fire season.

AGL Hydro shall maintain links with the local government agencies such as the CFA, Parks Victoria, Water NSW and DELWP to ensure swift and effective, response to fire ignition within its area of responsibility.

A Victorian firefighting capability statement and response plan shall be distributed to the DELWP and CFA prior to the fire season each year detailing what AGL Hydro resources are available to fire agencies.

14. Public Awareness Programs

AGL Hydro has no private electric supply lines connected to any of its overhead assets. Where AGL Hydro has overhead lines passing over private or public land it shall inform, and make aware, the land holders of their obligations about ensuring limits of approach and clearance distances are maintained, allowing access for periodic inspections, and what actions will need to be undertaken if there is a non-compliance. This will be achieved by informing land holders in writing of AGL Hydro's needs for asset access and inspection times, their rights, and the procedure for settlement of any grievances arising.

15. Plan available for inspection

As per Section 83BA (3) (a) of the Act, the latest ESV approved Bushfire Mitigation Plan is available on the AGL internet site at: https://www.agl.com.au/about-agl/how-we-source-energy/hydroelectric-assets


Any superseded versions of the plan located at the above websites will be overwritten by the AGL Hydro person responsible for preparing the plan once an updated version of the document has been approved/accepted by ESV.

A hardcopy of the ESV approved/accepted Bushfire Mitigation Plan mentioned above is available for inspection at AGL Hydro's Mt Beauty Administration office, during normal business hours, located at Kiewa Valley Hwy, Mt Beauty 3699. Any hardcopy superseded versions of the plan will be destroyed by the person responsible for preparing the plan.

AGL Hydro Bushfire Mitigation Plan 2021-2022 (ML APPTOYS) Date: 04/11/2021 Document ID: 9708169
Release Number: 22 Approved By: Stuart Cariss (A119880) Next Review Date: 03/11/2022
Owner: Hydro Manager Uncontrolled When Printed 28 of 74

16. Victorian Assets

All overhead electric lines outline in this section are in a Hazardous Bushfire Risk Areas (HBRA).

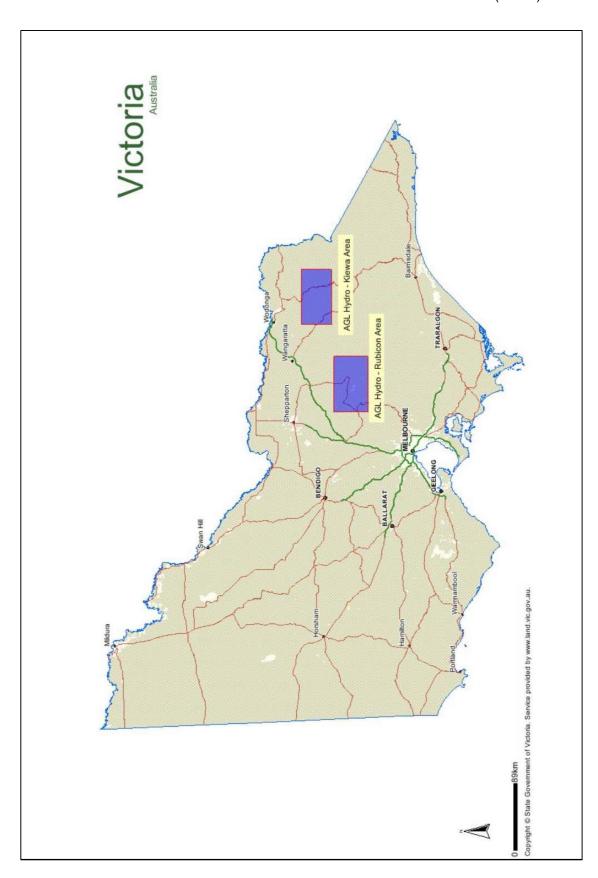

Document ID: 9708469

29 of 74

16.1. Kiewa Hydro Scheme Assets

16.1.1. Mount Beauty Depot and Regulating Pondage






16.1.2. West Kiewa Power Station





16.1.3. Clover Power Station

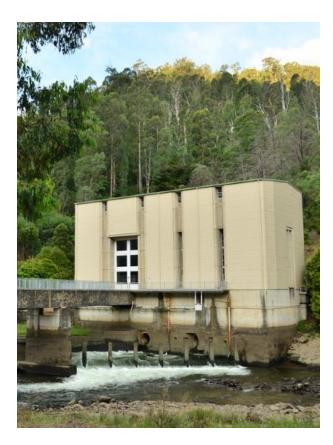



16.1.4. Bogong Power Station






16.1.5. McKay Creek Power Station






16.2. Dartmouth Hydro Scheme Assets

16.2.1. Dartmouth Power Station

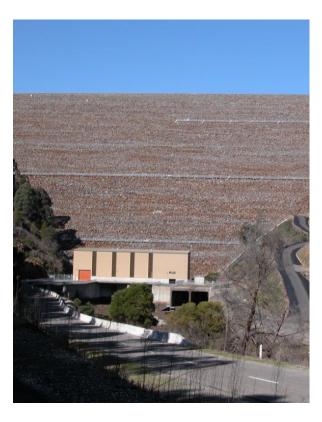

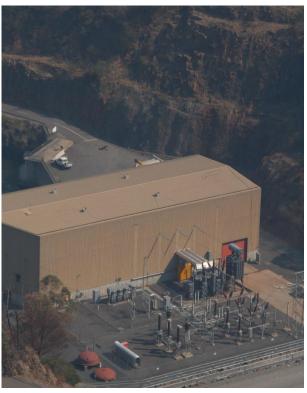


16.2.2. Banimboola Power Station






16.3. Yarrawonga Power Station Assets

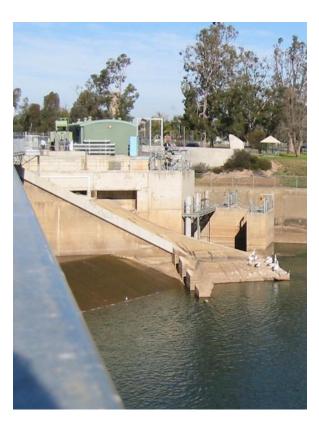



16.4. Eildon Power Station Assets

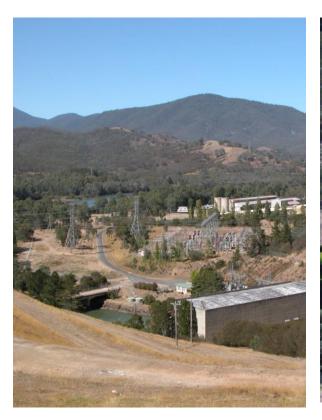



16.5. Kiewa Hydro Scheme Overhead Powerlines

This section relates to all overhead electric lines in the Kiewa Hazardous Bushfire Risk Area (HBRA).

16.5.1. Kiewa – Mount Beauty Depot



16.5.2. Kiewa – West Kiewa



AGL Hydro Bushfire Mitigation Plan 2021-2022 (ML APPTOG) Date: 04/11/2021 Document ID: 9703169
Release Number: 22 Approved By: Stuart Cariss (A119880) Next Review Date: 03/11/2022
Owner: Hydro Manager Uncontrolled When Printed 35 of 74

16.5.3. Kiewa – Clover and Bogong Creek Raceline



16.5.4. Kiewa – Bogong



16.5.5. Kiewa – McKay Crk PS





16.6. Rubicon Hydro Scheme Assets

16.6.1. Lower Rubicon PS





16.6.2. Rubicon PS





16.6.3. Rubicon Fall PS




16.6.4. Royston PS



16.7. Rubicon Hydro Scheme Overhead Powerlines

This section relates to all overhead electric lines in the Rubicon Hazardous Bushfire Risk Area (HBRA).

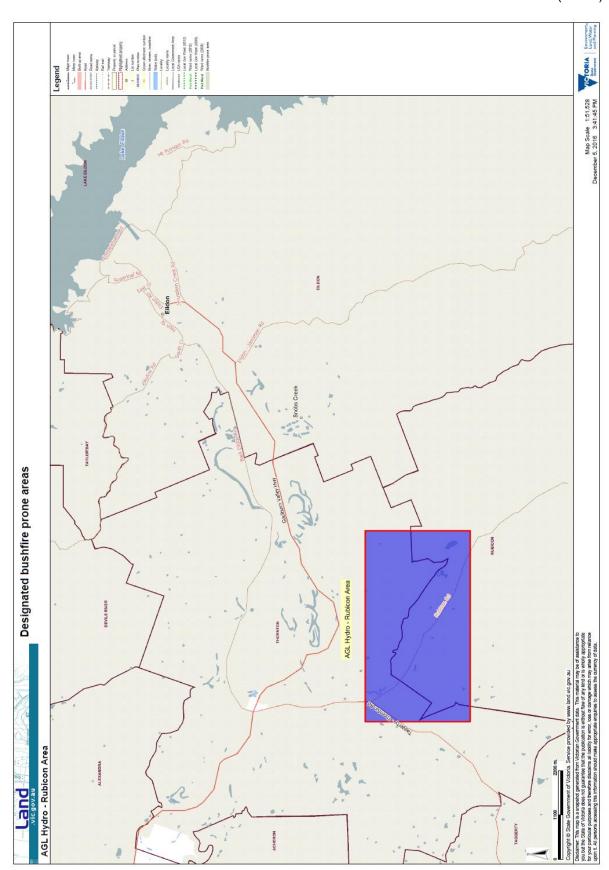

16.7.1. Rubicon A - Rubicon PS (Image 1)



16.7.2. Rubicon A - Rubicon PS including Lower Rubicon (Image 2)



16.7.3. Rubicon A - Rubicon PS (Image 3)



16.7.4. Rubicon PS



16.7.5. Rubicon Falls PS




16.7.6. Royston PS



16.8. NSW Assets

All NSW overhead electric lines are located with the confines of the power station switchyard of each asset located in the following Hazardous Bushfire Risk Areas (HBRA).

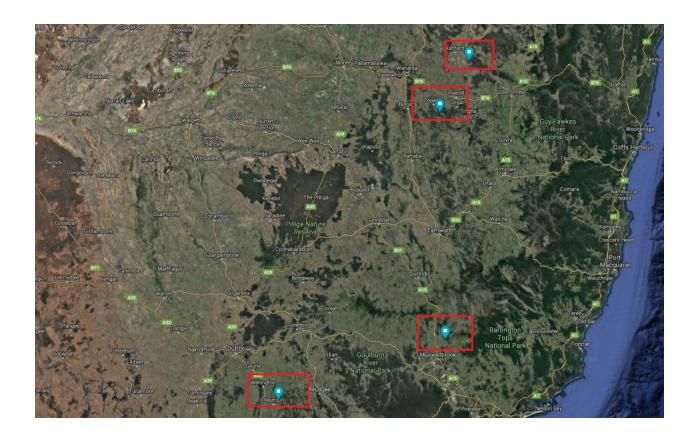

16.8.1. Pindari Power Station

Address

Pindari Dam Road

Connection Point:

Connection clamp to the 66kV incoming line to the AGL Pindari substation.

AGL Asset Ownership:

AGL Pindari substation infrastructure including incoming 66kV pole structure and 66kV line connection clamp and dropper cable.

TNSP Asset Ownership:

66kV incoming overhead line and insulator connected to the AGL incoming overhead line pole structure.



45

NSW Rural Fire Service bushfire prone area assessment:

Bushfire Prone Location



16.8.2. Copeton Power Station

| Address | Copeton Dam Road | | | |
|---------|------------------|--|--|--|
|---------|------------------|--|--|--|

Document ID: 9708169 Next Review Date: 03/11/2022 46 of 74

46

Connection Point:

66kV incoming line aerial terminations on the AGL Copeton substation overhead landing span structure.


AGL Asset Ownership:

AGL Copeton substation infrastructure including incoming 66kV landing span structure and 66kV line connection clamp and dropper cable.

TNSP Asset Ownership:

66kV incoming overhead line and insulator connected to the AGL incoming overhead line landing span structure.

Owner: Hydro Manager

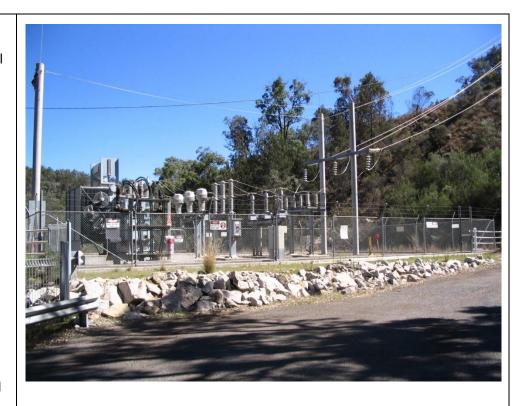

NSW Rural Fire Service bushfire prone area assessment:

Bushfire Prone Location



Owner: Hydro Manager

16.8.3. Burrendong Power Station

Address

Burrednong Dam Road

Connection Point:


132kV incoming line aerial terminations on the AGL Burrendong substation overhead landing span structure.

AGL Asset Ownership:

AGL Burrendong substation infrastructure including incoming 132kV landing span structure and 132kV line connection clamp and dropper cable.

TNSP Asset Ownership:

132kV incoming overhead line and insulator connected to the AGL incoming overhead line landing span structure.

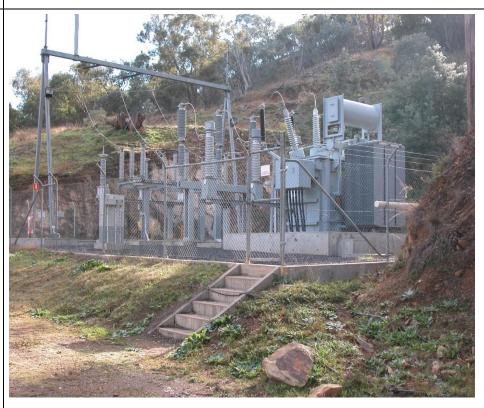

NSW Rural Fire Service bushfire prone area assessment:

Bushfire Prone Location



Owner: Hydro Manager

50

16.8.4. Glenbawn Power Station

Address

Glenbawn Dam Road

Connection Point:

33kV incoming line terminations on the AGL Glenbawn rotary air break switch located on the AGL Glenbawn substation overhead landing span structure.

AGL Asset Ownership:

AGL Glenbawn substation infrastructure including incoming 33kV landing span structure.

TNSP Asset Ownership:

33kV incoming overhead line and insulator (connected to the AGL incoming overhead line landing span structure) and dropper cable to the AGL Glenbawn rotary air break switch.



NSW Rural Fire Service bushfire prone area assessment:

Bushfire Prone Location



Owner: Hydro Manager

17. Appendices

17.1. Reporting Organisational Structure


AGL Hydro Bushfire Mitigation Plan 2021-2022 (ML AL FI 01)
Release Number: 22
Approved By: Stuart Cariss (A119880)
Owner: Hydro Manager


Approved By: Stuart Cariss (A119880)
Uncontrolled When Printed

Document ID: 9708169
Next Review Date: 03/11/2022

Uncontrolled When Printed

53 of 74



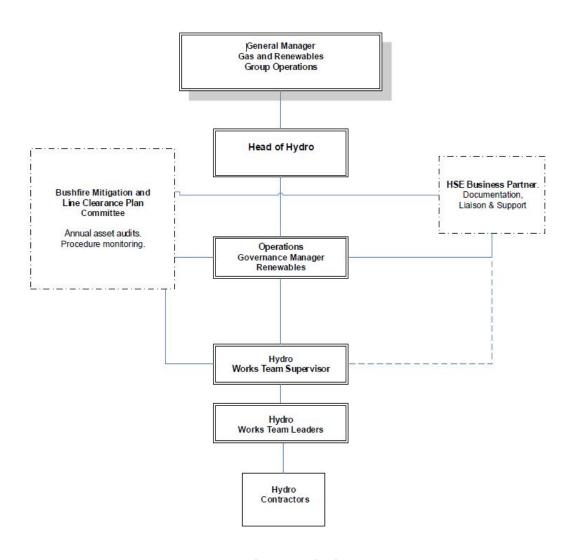

AGL Hydro Bushfire Mitigation Plan 2021-2 Release Number: 22

Owner: Hydro Manager

Approved Date: 04/11/2021 Approved By: Stuart Cariss (A119880) Uncontrolled When Printed Document ID: 9708169 Next Review Date: 03/11/2022

54 of 74

17.2. AGL Hydro at-risk electric lines

The following table is an extract from our AGL Hydro electrical line pole and line register representing the AGL Hydro at-risk electrical lines.

| letwork Ref | Line Ref | Material | Process | Treatment | Overall Length | Height | GL Diameter | Original Diameter | Install Year | Pole Function | Terrain | Diamete Dd |
|-------------|-----------------|----------|-------------------|---------------------|-------------------|--------|-------------|----------------------|--------------|---|---|---------------|
| 961001 | WEST KIEWA | HHD (S3) | Natural | CCA | 12.5 | 10.5 | 310 | 310 | 2005 | Strain | TC4 - Sheltered 10m-30m high | 290 |
| 961002 | NORTH KIEWA | SHD (S5) | Natural | Natural | 9.2 | 7.2 | 340 | 340 | 1942 | Strain | TC4 - Sheltered 10m-30m high | 315 |
| 961004 | WEST KIEWA | HHD (S3) | Natural | Creosote | 11.8 | 9.8 | 300 | 300 | 1981 | Strain | TC4 - Sheltered 10m-30m high | 110 |
| 961004 | WEST KIEWA | HHD (S3) | Natural | Creosote | 11.8 | 9.8 | 300 | 285 | 1981 | Strain | TC4 - Sheltered 10m-30m high | 110 |
| 961005 | WEST KIEWA | HHD (S2) | Peeled | Natural | 9.5 | 7.5 | 287 | 287 | 1986 | Angle | TC4 - Sheltered 10m-30m high | 278 |
| 961010 | WEST KIEWA | HHD (S3) | Natural | CCA | 13 | 11 | 365 | 365 | 2005 | Strain | TC4 - Sheltered 10m-30m high | 370 |
| 961011 | WEST KIEWA | HHD (S2) | Natural | CCA | 14 | 12 | 385 | 385 | 2005 | Strain | TC4 - Sheltered 10m-30m high | 357 |
| 961016 | WEST KIEWA | HHD (S3) | Natural | CCA | 14 | 12 | 336 | 336 | 2005 | Strain | TC4 - Sheltered 10m-30m high | 320 |
| 961152 | MCKAY CREEK | HHD (S3) | Natural | Natural | 12.5 | 10.5 | 328 | 328 | 2000 | Intermediate | TC2.5 - Sheltered few | 327 |
| 961153 | MCKAY CREEK | HHD (S4) | Natural | Natural | 12 | 10 | 257 | 257 | 2000 | Intermediate | TC2.5 - Sheltered few | 194 |
| 961156 | MCKAY CREEK | HHD (S4) | Natural | Creosote | 11.5 | 9.5 | 330 | 330 | 1970 | Strain | TC2.5 - Sheltered few | 203 |
| 961198 | MT BEAUTY DEPOT | HHD (S3) | Peeled | Natural | 10.5 | 8.5 | 290 | 291 | 2000 | Intermediate | TC2.5 - Sheltered few | 267 |
| 961199 | MT BEAUTY DEPOT | HHD (S3) | Natural | Natural | 10.5 | 8.5 | 279 | 279 | 2000 | Intermediate | TC2.5 - Sheltered few | 287 |
| 961200 | MT BEAUTY DEPOT | HHD (S4) | Natural | Natural | 10 | 8 | 312 | 312 | 2000 | Termination | TC2.5 - Sheltered few | 295 |
| 961202 | JUNCTION DAM | HHD (S2) | Peeled | Natural | 10.5 | 8.5 | 365 | 365 | 1942 | Termination | TC4 - Sheltered 10m-30m high | 352 |
| 961206 | BOGONG VILLAGE | HHD (S4) | Peeled | Natural | 10.5 | 8.5 | 340 | 340 | 1942 | Angle | TC4 - Sheltered 10m-30m high | 283 |
| 961207 | BOGONG VILLAGE | HHD (S4) | Peeled | Natural | 10.5 | 8.5 | 241 | 241 | 1942 | Termination | TC4 - Sheltered 10m-30m high | 208 |
| 961213 | PONDAGE 2 | HHD (S3) | Natural | Creosote | 12 | 10 | 304 | 304 | 1976 | Termination | TC2.5 - Sheltered few | 110 |
| 961218 | YARD 3 | HHD (S4) | Natural | CCA | 14 | 12 | 329 | 329 | 2005 | Intermediate | TC2.5 - Sheltered few | 215 |
| 961220 | YARD 5 | HHD (S4) | Peeled | Natural | 12 | 10 | 338 | 338 | 1986 | Termination | TC2.5 - Sheltered few | 210 |
| 962001 | RUBICON | HHD (S3) | Natural | Natural | 12 | 10 | 365 | 365 | 1972 | Termination | TC4 - Sheltered 10m-30m high | 361 |
| 962002 | RUBICON | HHD (S1) | Peeled | Natural | 12.5 | 10.5 | 355 | 355 | 1988 | Termination | TC4 - Sheltered 10m-30m high | 330 |
| 962005 | RUBICON | HHD (S3) | Peeled | Natural | 9 | 7 | 330 | 330 | 1972 | Intermediate | TC4 - Sheltered 10m-30m high | 295 |
| 9621012 | RUBICON | HHD (S3) | Natural | Creosote | 10 | 8 | 323 | 323 | 1972 | Termination | TC4 - Sheltered 10m-30m high | 180 |
| 962014 | RUBICON | HHD (S1) | Peeled | Natural | 8.5 | 6.5 | 265 | 265 | 1990 | Strain | TC4 - Sheltered 10m-30m high | 255 |
| 962015 | RUBICON | HHD (S3) | Natural | Natural | 9.5 | 7.5 | 215 | 215 | 1972 | Strain | TC4 - Sheltered 10m-30m high | 230 |
| 962015 | RUBICON | HHD (S3) | | | 9.5 | 7.5 | 250 | 250 | 1972 | | | 250 |
| 962016 | RUBICON | SHD (S5) | Peeled Natural | Natural Creosote | 9.5 | 10 | 293 | 305 | 1972 | Termination Termination | TC4 - Sheltered 10m-30m high TC2.5 - Sheltered few | 175 |
| 962050 | | | | | 12.5 | 10.5 | 353 | 353 | 1986 | Strain | | 270 |
| | RUBICON | HHD (S4) | Peeled | Natural | | | | | | | TC2.5 - Sheltered few | |
| 962051 | RUBICON | HHD (S2) | Peeled | Natural | 11.5 | 9.5 | 360 | 360 | 1986 | Strain | TC2.5 - Sheltered few | 331 |
| 962052 | RUBICON | HHD (S1) | Natural | CCA | 12 | 10 | 350 | 350 | 2012 | Strain | TC2.5 - Sheltered few | 244 |
| 962054 | RUBICON | HHD (S3) | Peeled | Natural | 10.5 | 8.5 | 305 | 305 | 1986 | Strain | TC2.5 - Sheltered few | 291 |
| 962055 | RUBICON | HHD (S4) | Peeled | Natural | 12.5 | 10.5 | 435 | 435 | 1986 | Intermediate | TC2.5 - Sheltered few | 292 |
| 962056 | RUBICON | HHD (S3) | Natural | Natural | 12 | 10 | 303 | 303 | 1981 | 400000000000000000000000000000000000000 | TC4 - Sheltered 10m-30m high | 280 |
| 962057 | RUBICON | HHD (S4) | Natural | Creosote | 12 | 10 | 285 | 285 | 1972 | Intermediate | TC4 - Sheltered 10m-30m high | 188 |
| 962058 | RUBICON | HHD (S3) | Natural | Creosote | 21 | 18 | 390 | 390 | 1981 | Strain | TC4 - Sheltered 10m-30m high | 130 |
| 962060 | RUBICON | HHD (S4) | Natural | Creosote | 20 | 17.5 | 430 | 430 | 1981 | | TC4 - Sheltered 10m-30m high | 60 |
| 962060 | RUBICON | HHD (S4) | Natural | Creosote | 20 | 17.5 | 430 | 430 | 1981 | | TC4 - Sheltered 10m-30m high | 60 |
| 962061 | RUBICON | HHD (S3) | Natural | Natural | 12 | 10 | 300 | 300 | 1972 | | TC4 - Sheltered 10m-30m high | 293 |
| 962078 | RUBICON | SHD (S5) | Natural | Creosote | 16 | 14 | 450 | 450 | 1976 | Strain | TC2.5 - Sheltered few | 138 |
| 962079 | RUBICON | HHD (S4) | Natural | Creosote | 17 | 15 | 390 | 390 | 1976 | Strain | TC2.5 - Sheltered few | 115 |
| 962080 | RUBICON | HHD (S4) | Peeled | Natural | 16 | 14 | 405 | 405 | 1943 | TeeOff | TC2.5 - Sheltered few | 365 |
| 962081 | RUBICON | HHD (S3) | Natural | Creosote | 11.5 | 9.5 | 275 | 275 | 1973 | | TC2.5 - Sheltered few | 275 |
| 962082 | RUBICON | HHD (S3) | Natural | Creosote | 12 | 10 | 310 | 310 | 1972 | Termination | TC2.5 - Sheltered few | 282 |
| 962083 | RUBICON | HHD (S3) | Natural | Creosote | 10.7 | 8.7 | 210 | 210 | 1972 | TeeOff | TC2.5 - Sheltered few | 215 |
| 962084 | RUBICON | HHD (S2) | Natural | Creosote | 9 | 7 | 209 | 209 | 1973 | Termination | TC2.5 - Sheltered few | 202 |
| 962085 | RUBICON | HHD (S3) | Natural | Creosote | 9 | 7 | 215 | 215 | 1972 | Termination | TC2.5 - Sheltered few | 195 |
| 962088 | RUBICON | HHD (S3) | Natural | Creosote | 14 | 12 | 405 | 405 | 1976 | Intermediate | TC2.5 - Sheltered few | 244 |

AGL Hydro Bushfire Mitigation Plan 2021-2022 (ML AL FI 01)
Release Number: 22

Owner: Hydro Manager

Approved Date: 04/11/2021
Approved By: Stuart Cariss (A119880)
Uncontrolled When Printed

Document ID: 9708169 Next Review Date: 03/11/2022

| Network Ref | Line Ref | Material | Process | Treatment | Overall Length | Height | GL Diameter | Original Diameter | Install Year | Pole Function | Terrain | Diamete Dd |
|-------------|----------|----------|---------|-----------|-------------------|--------|-------------|----------------------|--------------|---------------|------------------------------|---------------|
| 962089 | RUBICON | HHD (S4) | Natural | Creosote | 16 | 13.5 | 430 | 430 | 1972 | Strain | TC3 - Sheltered 3m-10m high | 155 |
| 962090 | RUBICON | HHD (S1) | Peeled | Natural | 15 | 13 | 365 | 365 | 1938 | Strain | TC3 - Sheltered 3m-10m high | 250 |
| 962091 | RUBICON | HHD (S3) | Natural | CCA | 10.2 | 8.2 | 365 | 365 | 2005 | Termination | TC2.5 - Sheltered few | 360 |
| 962092 | RUBICON | HHD (S3) | Peeled | Natural | 16 | 14 | 370 | 370 | 1985 | Intermediate | TC4 - Sheltered 10m-30m high | 250 |
| 962093 | RUBICON | HHD (S4) | Natural | CCA | 14 | 12 | 345 | 345 | 2007 | Intermediate | TC4 - Sheltered 10m-30m high | 340 |
| 962094 | RUBICON | HHD (S3) | Peeled | Natural | 16 | 13.5 | 345 | 345 | 1983 | Intermediate | TC2.5 - Sheltered few | 259 |
| 962095 | RUBICON | HHD (S3) | Shaved | Natural | 15.5 | 13.5 | 340 | 340 | 1900 | Angle | TC2.5 - Sheltered few | 377 |
| 962096 | RUBICON | HHD (S3) | Shaved | Natural | 16 | 14 | 375 | 375 | 1900 | Angle | TC2.5 - Sheltered few | 270 |
| 962097 | RUBICON | SHD (S5) | Natural | CCA | 14.5 | 12.5 | 367 | 367 | 2010 | Intermediate | TC4 - Sheltered 10m-30m high | 364 |
| 962098 | RUBICON | HHD (S3) | Peeled | Natural | 14.5 | 12.5 | 336 | 336 | 1938 | Intermediate | TC4 - Sheltered 10m-30m high | 342 |
| 962099 | RUBICON | HHD (S1) | Peeled | Natural | 16 | 14 | 390 | 390 | 1990 | Intermediate | TC4 - Sheltered 10m-30m high | 254 |
| 962100 | RUBICON | HHD (S4) | Peeled | Natural | 19 | 16 | 390 | 390 | 1986 | Intermediate | TC4 - Sheltered 10m-30m high | 380 |
| 962101 | RUBICON | HHD (S3) | Shaved | Natural | 15 | 13 | 390 | 390 | 1939 | Intermediate | TC4 - Sheltered 10m-30m high | 255 |
| 962102 | RUBICON | HHD (S1) | Peeled | Natural | 16 | 14 | 390 | 390 | 1938 | Intermediate | TC4 - Sheltered 10m-30m high | 250 |
| 962103 | RUBICON | HHD (S4) | Shaved | Natural | 17 | 15 | 355 | 355 | 2000 | Intermediate | TC4 - Sheltered 10m-30m high | 361 |
| 962104 | RUBICON | HHD (S3) | Natural | CCA | 17 | 14.2 | 385 | 385 | 2013 | Intermediate | TC2.5 - Sheltered few | 355 |
| 962105 | RUBICON | HHD (S2) | Natural | Creosote | 16 | 14 | 385 | 385 | 1976 | Intermediate | TC2.5 - Sheltered few | 118 |
| 962106 | RUBICON | HHD (S4) | Natural | Creosote | 14.3 | 12.3 | 382 | 382 | 1976 | Strain | TC2.5 - Sheltered few | 257 |
| 962107 | RUBICON | HHD (S1) | Peeled | Natural | 13 | 11 | 365 | 365 | 1985 | Intermediate | TC2.5 - Sheltered few | 350 |
| 962108 | RUBICON | HHD (S3) | Peeled | Natural | 13.5 | 11.5 | 427 | 427 | 1986 | Intermediate | TC2.5 - Sheltered few | 435 |
| 962109 | RUBICON | HHD (S3) | Peeled | Natural | 14 | 12 | 380 | 376 | 1985 | Angle | TC2.5 - Sheltered few | 353 |
| 962115 | RUBICON | HHD (S4) | Natural | CCA | 18 | 15.5 | 395 | 395 | 2012 | TeeOff | TC2.5 - Sheltered few | 380 |
| 962116 | RUBICON | HHD (S3) | Peeled | Natural | 13 | 11 | 335 | 335 | 1990 | TeeOff | TC2.5 - Sheltered few | 305 |
| 962117 | RUBICON | HHD (S2) | Natural | CCA | 17 | 14.5 | 357 | 357 | 2012 | Intermediate | TC2.5 - Sheltered few | 230 |
| 962121 | RUBICON | HHD (S1) | Peeled | Natural | 16 | 13.5 | 363 | 363 | 1988 | Intermediate | TC2.5 - Sheltered few | 257 |
| 962122 | RUBICON | HHD (S3) | Peeled | Natural | 16 | 14 | 405 | 405 | 1990 | Intermediate | TC2.5 - Sheltered few | 388 |
| 962124 | RUBICON | HHD (S3) | Natural | Creosote | 14.5 | 12.5 | 362 | 362 | 1967 | Intermediate | TC2.5 - Sheltered few | 230 |
| 962126 | RUBICON | HHD (S4) | Natural | CCA | 14.5 | 12.5 | 357 | 357 | 2012 | Intermediate | TC2.5 - Sheltered few | 337 |
| 962128 | RUBICON | SHD (S5) | Natural | Creosote | 15 | 13 | 423 | 423 | 1973 | Intermediate | TC2.5 - Sheltered few | 280 |
| 962129 | RUBICON | HHD (S3) | Natural | Creosote | 16 | 14 | 422 | 422 | 2000 | Intermediate | TC2 - Open terrain | 75 |
| 962131 | RUBICON | HHD (S3) | Peeled | Natural | 16 | 14 | 337 | 337 | 1983 | Intermediate | TC2.5 - Sheltered few | 257 |
| 962133 | RUBICON | HHD (S1) | Peeled | Natural | 15 | 13 | 373 | 373 | 1991 | Intermediate | TC2.5 - Sheltered few | 345 |
| 962134 | RUBICON | HHD (S3) | Natural | Natural | 14 | 12 | 305 | 305 | 1944 | Intermediate | TC2.5 - Sheltered few | 340 |
| 962135 | RUBICON | HHD (S3) | Shaved | Natural | 15 | 13 | 340 | 340 | 1944 | Strain | TC2.5 - Sheltered few | 388 |
| 962136 | RUBICON | HHD (S3) | Natural | Creosote | 13 | 11 | 358 | 358 | 1944 | Strain | TC2.5 - Sheltered few | 326 |
| 962137 | RUBICON | HHD (S3) | Peeled | Natural | 13 | 11 | 323 | 323 | 1944 | Strain | TC2.5 - Sheltered few | 345 |
| 962138 | RUBICON | HHD (S3) | Peeled | Natural | 13 | 11 | 365 | 365 | 1991 | Strain | TC2.5 - Sheltered few | 345 |

Owner: Hydro Manager

56

17.3. **Fire Report Form**



| Date: | Time: | | | Reporting Officer: |
|---|-----------------|-------------------------|--|--|
| | | | | |
| Significant fire, ie: injury o encing, details should be Renewable Operations M | immediately ph | age to sto oned to t | ck or property whi he Manager of Re | ch includes tress, pasture and newables, Hydro Manager an |
| Incident Details: | | | | |
| Date and Time of Fire: | | | | |
| Fire Source and Local | ity: | | | |
| Pole Number: | | | | |
| Asset Number: | | | | |
| Map Reference: | | | | |
| | | | | |
| Environmental Details | : | | | |
| Weather at time of Fire |): | | | |
| Consequences of Fire | : (list damage) | | | |
| Injury or Death: | | | | |
| Area of Fire: | | | | |
| Day of Total Fire Ban: | | | | |
| Temperature: | | | | |
| Wind Direction: | | | | |
| Wind Speed (Kph): | | | | |
| Humidity (%): | | | | |
| | | | | |
| Pole Information: | | | | |
| Pole Number: | | | Pole Location: | |
| Nearest Asset: | | | Line Number: | |
| Last Inspection Date: | | | | |
| Pole Material: | Wood: Yes/I | No | Steel: Yes / No | Concrete: Yes / No |
| Cross-arm Material: | Wood: Yes/I | No | Steel: Yes / No | Concrete: Yes / No |
| Conductor Material: | SC: Yes / No | | AAC: Yes/No | ACSR: Yes / No |
| | CU: Yes / No | | | |



FIRE REPORT FORM

| Voltage and Current Information: | | | | | | | |
|----------------------------------|---|--|--|--|--|--|--|
| Fault Type: | Three Phase: Yes / No Phase to Ground: Yes / No | | | | | | |
| Voltage (KV): | | | | | | | |
| Fault Current (A): | | | | | | | |

| Contributing Factors: | | | | | |
|-------------------------|------|-------------------------|------|-----------------------|------|
| Assets | Tick | Assets | Tick | Assets | Tick |
| Conductor | | Joint Failure | | "D" burn Through | |
| Clashing | | Conductor Failure | | Fuse | |
| Tie Failure | | Bridging | | EDO operation | |
| EDO Hang up | | BA Failure | | Low Voltage | |
| PFF failure | | Transform Failure | | Switch Failure | |
| Insulator | Tick | Surge Diverter | Tick | Cross-Arm | Tick |
| Mechanical Failure | | Earth Leads | | Fire | |
| Electrical Failure | | End Cap | | Broken Cross-arm | |
| Pollution | | Surge Diverter failure | | Termites | |
| Salt | | | | Age rot | |
| Other | | | | Other | |
| Fauna | Tick | Lightning | Tick | Miscellaneous | Tick |
| Intermediate | | Fuse Separation | | Service Failure | |
| Structure | | Transformer Fail | | U/G Asset Failure | |
| Complex Structure | | Pole Failure | | Overload | |
| Substation Pole | | Miscellaneous | | Earthing Failure | |
| Mid Span/Bird/Animal | | Vehicle | | PEL Failure | |
| Zone Sub Feeder | Tick | ACR's | Tick | Fuses | Tick |
| Feeder CB tripped | | ACR Tripped | | Fuses Operated | |
| CB Tripped to lockout | | ARC Tripped lockout | | No of Fuses Operated. | |
| Auto Reclose Suppressed | | Auto Reclose Suppressed | | Fuse Type PFF | |
| No of trips | | Miscellaneous | | Fuse Type EDO | |
| Mid Span/Bird/Animal | | Vehicle | | Fuse Type Acid Boric | |
| Protection Operation | | Protection Operation | | Protection Operation | |
| Other: | | Other: | | Other: | |
| Other: | | Other: | | Other: | |

AGL Hydro Bushfire Mitigation Plan 2021-2022 (ML APPTOYS) Date: 04/11/2021 Document ID: 9708169
Release Number: 22 Approved By: Stuart Cariss (A119880) Next Review Date: 03/11/2022
Owner: Hydro Manager Uncontrolled When Printed 58 of 74



FIRE REPORT FORM

| Addit | ional Information | |
|---------|----------------------------|-----------------|
| | Comments | Property Owners |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| C:I. | | P |
| Signed: | | Date : |
| | (AGL Responsible Officer) | |
| | | |
| | | |
| | | |
| Cianod: | | Date: |
| oigneu. | | Date |
| | (Operations Manager) | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |

17.4. Pole Fire Report Form



POLE FIRE REPORT FORM

| Date: | Time: | Reporting Officer: |
|-------|-------|--------------------|
| | | |

Significant fire, ie: injury or death or damage to stock or property which includes tress, pasture and fencing, details should be immediately phoned to the Manager of Renewables, Hydro Manager and Renewable Operations Manager.

| Environmental Details: | |
|-------------------------------------|--|
| Weather at time of Fire: | |
| Consequences of Fire: (list damage) | |
| Injury or Death: | |
| Area of Fire: | |
| Day of Total Fire Ban: | |
| Temperature: | |
| Wind Direction: | |
| Wind Speed (Kph): | |
| Humidity (%): | |

| Pole Information: | | | | | | |
|-------------------|--------------------------------|--|--|--|--|--|
| | Pole Location: | | | | | |
| | Line Number: | | | | | |
| | | | | | | |
| Wood: Yes / No | Steel: Yes / No | Concrete: Yes / No | | | | |
| Wood: Yes / No | Steel: Yes / No | Concrete: Yes / No | | | | |
| SC: Yes / No | AAC: Yes/No | ACSR: Yes / No | | | | |
| CU: Yes / No | | | | | | |
| | Wood: Yes / No SC: Yes / No | Wood: Yes / No Steel: Yes / No Wood: Yes / No Steel: Yes / No SC: Yes / No AAC: Yes / No | | | | |



POLE FIRE REPORT FORM

| Voltage and Current Information: | | | | | | | |
|----------------------------------|---|--|--|--|--|--|--|
| Fault Type: | Fault Type: Three Phase: Yes / No Phase to Ground: Yes / No | | | | | | |
| Voltage (KV): | | | | | | | |
| Fault Current (A): | | | | | | | |

| Primary Cause of Fire: | | | | | |
|------------------------|------|--------------------|------|-------------------|------|
| Cause | Tick | Cause | Tick | Cause | Tick |
| Insulator damaged | | Insulator Polluted | | Equipment Failure | |
| Faulty | | Salt | | Broken Tie | |
| Lightning | | Dust Ordinary | | Other | |
| Vandalism | | Dust Abnormal | | Bird & Wire | |
| Other | | Other | | | |

| Weather at time of Fire | e: | | | | |
|-------------------------|------|-------------|------|----------|------|
| Atmospheric | Tick | Temperature | Tick | Wind | Tick |
| Fine | | Hot | | Strong | |
| Humid | | Mild | | Moderate | |
| Fog | | Cool | | Calm | |
| Rain | | | | | |
| Drizzle | | | | | |

| Bonding Methods: | | | | | |
|----------------------|------|------------------------|------|------------------------------------|------|
| Plates or Shunt Arms | Tick | Conical Springs Fitted | Tick | Earthing Connection to Fittings | Tick |
| X-arm Insulators | | X-arm Insulators | | x-arm | |
| Brace Bolt | | Brace Bolt | | Pole | |
| Pole Cap | | Pole Cap | | Fuse Bracket | |
| King Bolt | | King Bolt | | Other * | |
| Fuse Bracket | | Fuse Bracket | | None Fitted | |
| None Fitted | | Coach screw | | * please specify in comments | |

AGL Hydro Bushfire Mitigation Plan 2021-2022 (ML APPROVED Date: 04/11/2021 Document ID: 9708169
Release Number: 22 Approved By: Stuart Cariss (A119880) Next Review Date: 03/11/2022
Owner: Hydro Manager Uncontrolled When Printed 61 of 74



POLE FIRE REPORT FORM

| Comm | ents |
|--------|----------------------------|
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| ioned: | Date : |
| | |
| | (AGL Responsible Officer) |
| | |
| | |
| | |
| | |
| : | Date: |
| ignea | Date |
| | (Operations Manager) |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |

17.5. Pole and Cross Arm Failure Report



POLE AND CROSSARM FAILURE REPORT

| Date: | Time: | Reporting Officer: |
|-------|-------|--------------------|
| | | |

The purpose of this form is for when a pole has fallen due to deterioration or when free movement of the pole is possible and the pole is supported only by conductors, stays, services, ie: The pole base has no resistance to bending movement.

| Incident Details: | |
|-----------------------------|--|
| Date and Time of Fire: | |
| Fire Source and Locality: | |
| Pole Number: | |
| Asset Number: | |
| Map Reference: | |
| Fire Report Form Submitted: | |

| Environmental Details: | |
|-------------------------------------|--|
| Weather at time of Fire: | |
| Consequences of Fire: (list damage) | |
| Injury or Death: | |
| Area of Fire: | |
| Day of Total Fire Ban: | |
| Temperature: | |
| Wind Direction: | |
| Wind Speed (Kph): | |
| Humidity (%): | |

| Pole Information: | | | |
|-----------------------|----------------|-----------------|--------------------|
| Pole Number: | | Pole Location: | |
| Nearest Asset: | | Line Number: | |
| Last Inspection Date: | | | |
| Pole Material: | Wood: Yes / No | Steel: Yes / No | Concrete: Yes / No |
| Cross-arm Material: | Wood: Yes / No | Steel: Yes / No | Concrete: Yes / No |
| Conductor Material: | SC: Yes / No | AAC: Yes/No | ACSR: Yes / No |
| | CU: Yes / No | | |



POLE AND CROSSARM FAILURE REPORT

| Consequence | Tick | Voltage Type | Tick |
|-----------------|------|--------------|------|
| Injury | | Low Voltage | |
| Death | | 6.6KV | |
| Material Damage | | 11KV | Xv. |
| Significant | | 22KV | 3) |
| Negligible | | Other | |

| Additional Information | |
|-----------------------------------|--------|
| Comments | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| Signed:(AGL Responsible Officer) | Date : |
| igned:(Operations Manager) | Date: |

AGL Hydro Bushfire Mitigation Plan 2021-2022 (ML APPROVED Date: 04/11/2021 Document ID: 9708469
Release Number: 22 Approved By: Stuart Cariss (A119880) Next Review Date: 03/11/2022
Owner: Hydro Manager Uncontrolled When Printed 64 of 74

17.6. **Bushfire Rating Index**

| Month End 21/4/16 | | | | | | |
|-------------------|--------------------------------------|------------------------------|----------------------------|----------------------------|-----------------------------|----------------------|
| Inspections | | | 2 | | | |
| Region | The case of the second second second | Line Inspection of Poles | Pre Summer Inspection | Routine Inspection | Poles Not Fire Safe - LL/US | to white con- |
| | Actual Number of poles | Actual Outstanding > 3 years | Actual Outstanding >1 year | Actual Outstanding >2 week | US > 12 Weeks | LL >12 Months |
| Kiewa Catchment | 56 | 0 | 0 | 0 | 0 | 0 |
| Rubicon Catchment | 92 | 0 | 0 | 0 | 0 | 0 |
| Caim Curran | 73 | 0 | 0 | 0 | 0 | 0 |
| Total Sth Hydro | 149 | 0 | 0 | 0 | 0 | 0 |
| Index Percentage | | 2 | 6 | 20 | 6 | 10 |
| Vegetation | | | | | | |
| Region | | Spans Not Cleared Pr. | ionity 1 & Priority 2 | | | |
| | Number of poles | Priority 1 > 1 week | Priority 2 > 4 weeks | | | |
| Kiewa Catchment | 56 | 0 | 0 | | | |
| Rubicon Catchment | 92 | 2 | 0 | | | |
| Caim Curran | 23 | 0 | 0 | | | |
| Total Sth Hydro | 149 | 9 | 0 | | | |
| Index Percentage | | 15 | 8 | | | |
| Pole Attachments | | | | | | |
| Region | | EDO's | Surge Diverters | | | |
| | Number of poles | Outstanding > 12 months | Outstanding > 4 Weeks | | | |
| Kiewa Catchment | 56 | 0 | 0 | | | |
| Rubicon Catchment | 92 | 0 | • | | | |
| Total Sh Hwdro | 140 | 0 | 0 | | | |
| Index Percentage | | 2 | 2 | | | |
| Region | | Attodiments | | Conductors | | 22 KTV Bird Corrers |
| 100 | Number of poles | Priority 1 O/S >4 weeks | Priority 2 O/S > 6 Months | Priority 1 O/S > 4 Weeks | Priority 2 > 6 months | Outstanding > 12 wee |
| Kiewa Catchment | 56 | 0 | 0 | 0 | 0 | 0 |
| Rubicon Catchment | 35 | 0 | • | 0 | 0 | 0 |
| Caim Curran | 2 | 0 | .0 | 0 | 0 | 0 |
| Total Sth Hydro | 149 | 0 | | . 0 | 0 | 0 |
| Index Percentage | | 80 | 2 | 69 | 2 | 2 |

65 of 74

17.7. Engineered Solutions

Engineered Solutions

AGL Hydro Bushfire Mitigation Plan 2021-22



| 2008 | Undergrounding of 5.3 km of overhead 6.6kV line between the Rubicon Haulage and Royston Power station |
|------|---|
| 2014 | Undergrounding of the 560m of overhead 240V line between the Royston Power station and the Royston Haulage |
| 2014 | Digital modernisation of the 22kV line protection throughout the scheme |
| 2015 | Undergrounding of 200m of the upper section of the 6.6kV line to Rubicon falls. |
| 2017 | Utilisation of fibre optical connection to site to enable dynamic line protection settings during high fire danger periods & TFB days |
| 2017 | Undergrounding of the 1300m 6.6kV line from the Rubicon Haulage to Rubicon Power station |
| 2019 | Rubicon A to Rubicon Power Station and Lower Rubicon Station 22kV overhead line REFCL hardening complete and is REFCL compliant |
| 2020 | Rubicon Power Station and Lower Rubicon Station 22kV and 6.6kV subnetwork electrical upgrades (REFCL hardening) |
| 2020 | Undergrounding the West Kiewa Power Station adit electrical winch LV overhead electrical supply |
| 2021 | Undergrounding the Junction Dam telemetry LV overhead electrical supply |
| 2021 | Undergrounding the Rubicon Haulage 6.6kV overhead electrical supply |
| | |

AGL Hydro Bushfire Mitigation Plan 2021-2022 (ML APPTOYS) Date: 04/11/2021 Document ID: 9708169
Release Number: 22 Approved By: Stuart Cariss (A119880) Next Review Date: 03/11/2022
Owner: Hydro Manager Uncontrolled When Printed 66 of 74


17.8. Victorian Asset Firefighting Capability Statement




AGL Hydro Bushfire Mitigation Plan 2021-2022 (ML APPROVED Date: 04/11/2021 Document ID: 9708169
Release Number: 22 Approved By: Stuart Cariss (A119880) Next Review Date: 03/11/2022
Owner: Hydro Manager Uncontrolled When Printed 67 of 74

17.9. AGL Hydro Vegetation Types


17.9.1. Mt Beauty

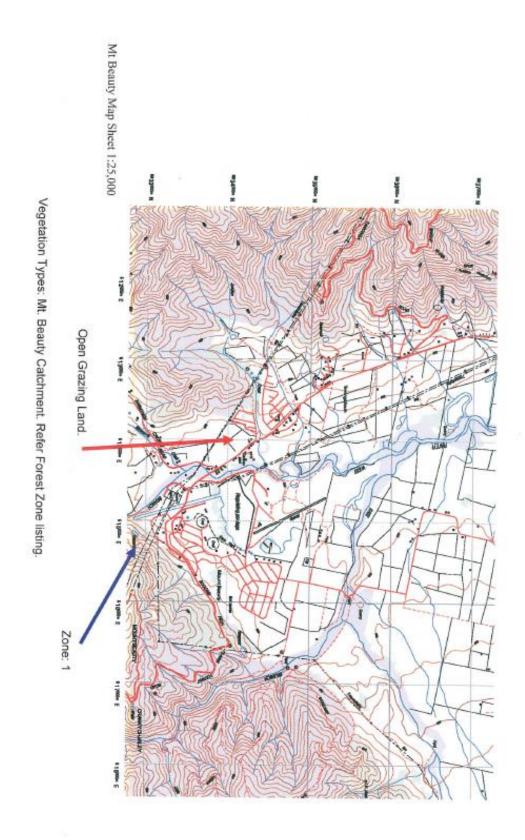

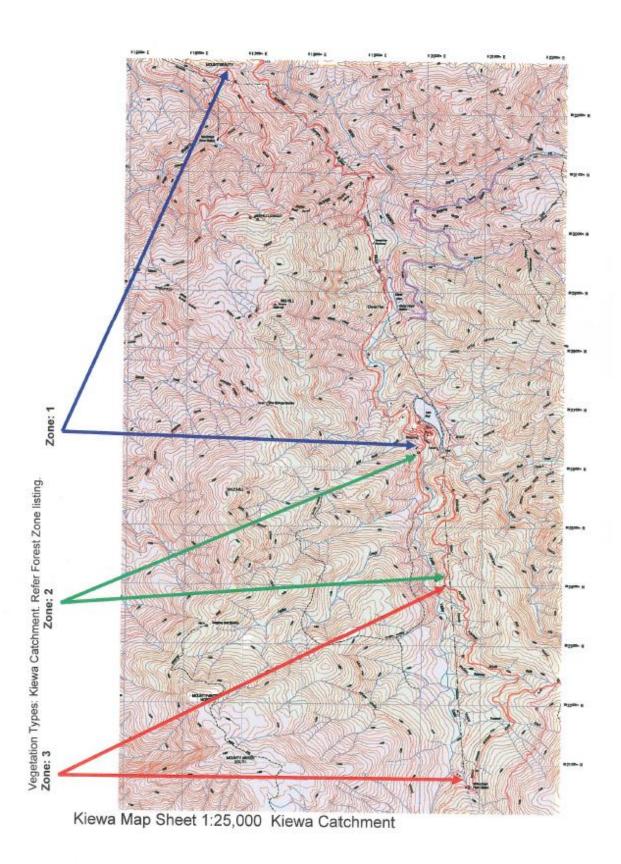

17.9.3. Rubicon Scheme

Rubicon Map Sheet 1:25,000

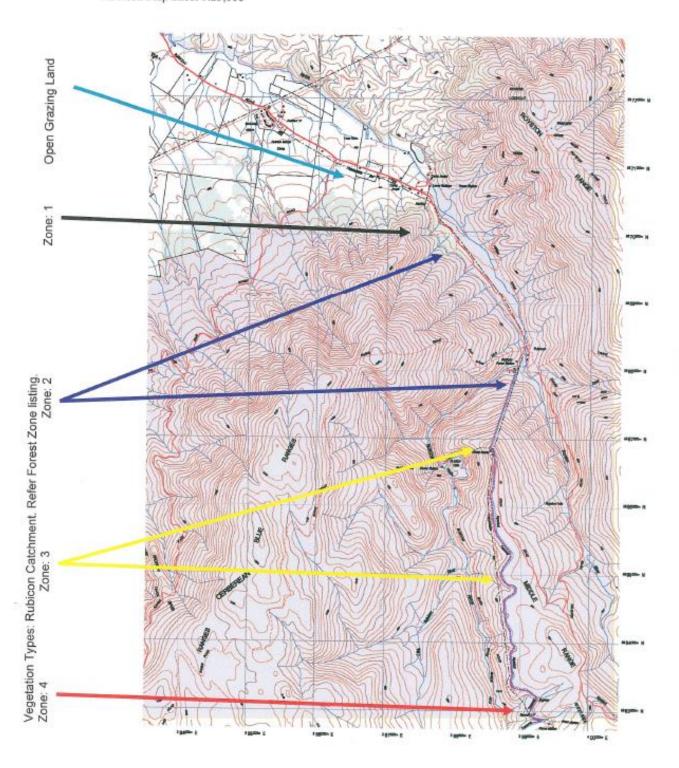

17.10. Works and Verification Schedule


The table below details all AGL Hydro assurance activities managed, scheduled, and tracked in SAP.

| Activity | Frequency | Timing | |
|---|-----------|-----------|--|
| Overhead Powerline Asset Inspections (Rubicon) | Weekly | N/A | |
| Overhead Powerline Asset Inspections (Kiewa) | Monthly | N/A | |
| Switchyard Inspections (Asset and Vegetation) | Monthly | N/A | |
| Access Track Inspections, Clearance and Maintenance | Monthly | N/A | |
| Overhead Powerline Vegetation Inspections | Monthly | N/A | |
| Bushfire Risk Index (During peak season) | Monthly | N/A | |
| Fire Appliance Testing (Chubb) | Bi-Annual | N/A | |
| Fixed Fire Systems Testing (Deluges and Monitoring Systems) | Bi-Annual | N/A | |
| Vegetation Line Clearance Verification Competency Review | Annually | April | |
| Vegetation Line Clearance Verifications | Annually | April | |
| Bushfire Mitigation Plan Review | Annually | June | |
| Line Clearance Plan Review | Annually | June | |
| Fire Fighting Capability Statement Review | Annually | June | |
| Annual Switchyard Inspections (Asset) | Annually | N/A | |
| Fire Fighting Equipment Inspections (Portable) | Annually | September | |
| Fire Training (Employees) | 3-yearly | October | |
| Pole and Pole Top Verification Competency Review | 3-yearly | April | |
| Pole and Pole Top Inspections (Cycled over 3 years) | 3-yearly | April | |

71 of 74

17.10.1. Kiewa Scheme (SAP Extract)

WKPQ01BFA10UC005-UC07

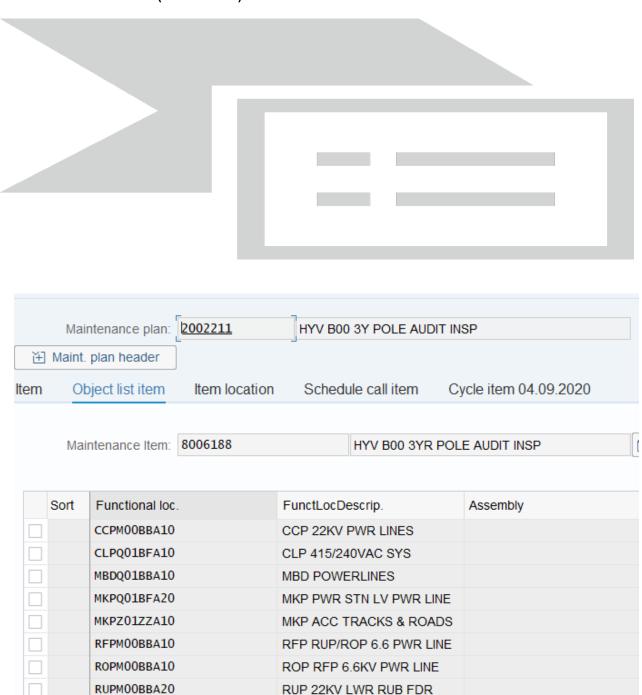

WKP LV PWR LINE FDR

17.10.2. Rubicon Scheme (SAP Extract)

| | Maintenance plan: | 2002028 RUP B | 00 1W PWR LN 8 | & ESMT INS | D | | | | |
|--|--|---------------------|----------------|-------------|----------|----------|---------------|--------------|-----------|
| Ħ | Maint. plan header | | | | | | | | |
| tem | Object list item | Item location Sche | dule call item | Cycle ite | m 04.09 | 9.202 | 20 | | |
| | | | | | | | | | |
| | Maintenance Item: | 8001204 | RUP B00 1Wk | (PWR LN & | ESMNT | INSP | | 1 1 2 | ? (G) |
| | | | | | | | | | |
| Refe | erence object | | | | | | | | |
| | Functional loc.: | RUPM00BBA20 | RUP 22 | KV LWR RU | IB FDR | | | | |
| | Equipment: | | 1101 22 | itt Ettitto | D I DIC | | | | |
| | | | | | | | | | |
| | Assembly: | | | | | | | | |
| | | | | | | | | | |
| | | | | | | | | | |
| | Maintenance nlan | 2002930 HVV | / R00 1V DWD I | INE VEG A | HDIT ING | SD. | | | |
| ×1 | Maintenance plan: 2002930 HYV B00 1Y PWR LINE VEG AUDIT INSP | | | | | | | | |
| | Maint. plan header | | | | | | | | |
| Item overview Item Object list item Item location Schedule call item Cycle item 04.09.2020 | | | | | | | | | |
| | | | | | | | | | |
| | Maintenance Item | Maintenance Item Te | ext | | O S | T | Functional Lo | ocation | |
| 0 | 8003388 RUP B00 1YR PWR LINE VE | | LINE VEG AUDI | T INSP | | ~ | RUPZ01 | | |
| 0 | 8006029 | CCP B00 1YR PWR | LINE VEG AUDI | T INSP | | ~ | CCPM00BBA | 10 | |
| 0 | 8003344 | CLP B00 1YR PWR | LINE VEG AUDIT | TINSP | | ✓ | CLPQ01BFA | 10UC006 | |
| 0 | <u>8003611</u> | LRP B00 1YR PWR | LINE VEG AUDIT | TINSP | | ✓ | LRPZ01 | | |
| 0 | <u>8002745</u> | MBD B00 1YR PWR | LINE VEG AUDI | TINSP | | √ | MBD | | |
| 0 | 8007033 | MKP B00 1YR PWR | | | | ✓ | MKPQ01BFA | <u>20</u> | |
| 0 | 8001624 | ROP B00 1YR 6.6 P | | | | ✓ | ROPZ01 | | |
| 0 | 8006653 | ROP B00 1YR LVPV | | | | V | ROPZ01 | 40110005 110 | 07 |
| 0 | 8004824 | WKP B00 1YR PWR | LINE VEG AUDI | TINSP | | ✓ | WKPQ01BFA | 100C005-UC | <u>07</u> |
| | | | | | | | | | |

18. Referenced Documents / Procedures

| Document Number | Document Title | | | |
|------------------------|---|--|--|--|
| AP MO AD 032 | Controlled Document Update Procedure | | | |
| CF MO AD 01 | Maintenance Notification - Corrective Action Request | | | |
| HI AL SF 02 | Emergency Management Plan | | | |
| HP AL AD 01 | Consultation, communication, and dispute resolution | | | |
| HP AL SF 08 | Contractors - Selection, Pre-Qualification and Management | | | |
| HQ AL SF 09 | Use of Personal Protective Equipment (PPE) | | | |
| HP AL SF 11 | Excavations Earthworks and Intrusion | | | |
| HP AL SF 35 | HSE Risk Management Procedure | | | |
| ML AL AD 00 | 00 AGL Hydro Asset Management Plan | | | |
| SP AL SF 01 | Electrical Safety Manual – Hydro | | | |
| SP AL PE 02 | HSE Induction and Authorisation | | | |
| SP AL RI 01 | Electrical Risk Register Procedure | | | |
| SP AL SA 50 | A 50 Safe Access Procedures | | | |
| TP AL HV 01 | V 01 HV Apparatus Energisation Testing Procedure | | | |
| AGL-HSE-STD-004.1 | AGL HSE Risk Management Standard | | | |
| AGL-HSE-SDM-004.1 | -SDM-004.1 AGL HSE Risk Management Standard Methodologies | | | |
| AGL-HSE-TMP-004.1 | TMP-004.1 AGL HSE Risk Management Standard Procedure Template | | | |
| AGL-HSE-GUI-012.1 | AGL Obligations to Notify Regulatory Authorities - Guideline | | | |
| AGL-HSE-PRO-012.1 | AGL HSE Incident, Near Miss and Hazard Management Procedure | | | |
| AGL-HSE-PRO-012.3 | AGL HSE Corporate Reporting Procedure | | | |
| AGL-HSE-STD-012 | AGL HSE Incident, Near Miss and Hazard Management Standard | | | |